

Taillight Lens Cracking

Service

Category Vehicle Exterior

Section

Door/Hatch

Market USA



Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION	
2013 – 2014	FR-S		

Introduction

The rear combination lights on some 2013 – 2014 model year FR-S vehicles may exhibit cracking from the upper surface of the lens. This can result from the trunk lid contacting the rear combination light housing if excessive force is applied to the trunk lid when closing. Follow the procedure in this bulletin to address this condition.

Production Change Information

This bulletin applies to vehicles produced **BEFORE** the Production Change Effective VIN shown below.

MODEL	DRIVETRAIN	PLANT	PRODUCTION CHANGE EFFECTIVE VII	
FR-S	FR-S RWD		JF1ZNAA1#E9702613	

Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
640301	R & R Luggage Compartment Weatherstrip	0.2	0.2 SU003-01469		44
BD1310	R & R Luggage Compartment Cushion	R Luggage Compartment Cushion 0.2 SU003-01472			14
811011	R & R Rear Combination Light Assembly (One Side)	0.3	SU003-02532	94	16
Combo A	R & R Rear Combination Light Assembly (Opposite Side)	0.2	SU003-02533		10

APPLICABLE WARRANTY

- This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.



Taillight Lens Cracking

S-SB-0041-13

Parts Information

PART N	IUMBER	DADT NAME	
PREVIOUS	NEW	PART NAME	QTY
SU003-01469	SU003-05128	Weatherstrip, Luggage Compartment Door	1
SU003-01472	SU003-05129	Cushion, Luggage Compartment Door	
SU003	3-02533	Lens & Body, Rear Combination Lamp, LH	1
SU003	3-02532	Lens & Body, Rear Combination Lamp, RH	1
SU003	3-04709	Gasket, Rear Combination Lamp, LH	1
SU003-04708		Gasket, Rear Combination Lamp, RH	1
SU003	3-04650	Nut (if necessary)	4

Required Tools & Equipment

SPECIAL SERVICE TOOLS (SST)	PART NUMBER	QTY	
Plastic Pry Tool Kit*	00002-06020-01	1	

^{*} Essential SST.

NOTE

Additional SSTs may be ordered by calling 1-800-933-8335.

Repair Procedure

1. Confirm the upper surface of the lens in the rear combination light is cracked.

Figure 1.

