

Rear Sunshade Binding on Package Tray

Service

Category Vehicle Interior

Section

Interior Panels/Trim

Market USA



Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION	
2013	Avalon, Avalon HV		

Introduction

Some 2013 model year Avalon and Avalon HV vehicles may exhibit a condition where the rear sunshade is inoperative and appears to be binding in the package tray. Please follow the process below to address this condition.

Production Change Information

This bulletin applies to vehicles produced **BEFORE** the Production Change Effective VINs shown below.

MODEL	PLANT	PRODUCTION CHANGE EFFECTIVE VIN
Avalon	TMANAG	4T1BK1EB#DU019347
Avalon HV	TMMK	4T1BD1EB#DU005050

Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
743061	R & R Package Tray Trim Panel Sub-assembly	0.7	64330-07030-## 64330-07040-##	94	57

APPLICABLE WARRANTY

- This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

Rear Sunshade Binding on Package Tray

T-SB-0038-13


Parts Information

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
64330-07030-A0			
64330-07030-B0	Same	Panel Assy, Package Tray Trim (w/ Audio 11 Speaker and Navigation)	1
64330-07030-C0		(W/ Addio 11 Opeaker and Navigation)	
64330-07040-A0			1
64330-07040-B0	Same	Panel Assy, Package Tray Trim	
64330-07040-C0			

Repair Procedure

1. Verify condition is present by cycling the rear sunshade and confirming interference with the package tray.

Figure 1.

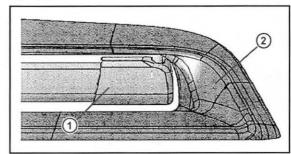

1	Sunshade	
2	Package Tray	

2. Replace the package tray according to Repair Manual instructions.

Refer to the Technical Information System (TIS), applicable model and model year Repair Manual:

- 2013 Avalon / Avalon HV: Audio/Visual/Telematics - Audio/Video - "Audio/Video: Rear Package Tray Speaker: Removal"
- 3. Reassemble the package tray according to Repair Manual instructions.

Refer to TIS, applicable model and model year Repair Manual:

 2013 Avalon / Avalon HV: Audio/Visual/Telematics - Audio/Video - "Audio/Video: Rear Package Tray Speaker: Installation"


Rear Sunshade Binding on Package Tray

T-SB-0038-13

Repair Procedure (Continued)

4. Check that there is clearance between the sunshade and package tray. Verify operation by cycling the rear sunshade.

Figure 2.

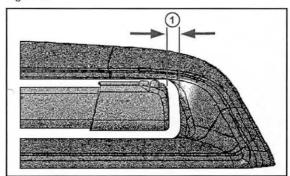

Clearance