T-SB-0082-13



Charge Schedule Function Inoperative Intermittently

Service

.

Category Audio/Visual/Telematics

Section Navigation/Multi Info Display

Market USA



Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION	
2012 – 2013	RAV4 EV		

Introduction

Some 2012 – 2013 model year RAV4 EV vehicles may experience a condition where the charge schedule function is intermittently inoperative. The condition may result from power interruption including: momentary blackout from the utility company, long term power outage, removing and reconnecting the charging plug, or other circumstances.

Follow the procedure in this bulletin to update the multi-information display software to address this condition.

NOTE

This software update does NOT affect:

Vehicle charge start time

The use of an EVSE timer

• Inability to charge on the 31st of the month

Production Change Information

This bulletin applies to vehicles produced **BEFORE** the Production Change Effective VIN shown below.

MODEL	PLANT	PRODUCTION CHANGE EFFECTIVE VIN
RAV4 EV	ТММС	2T3YL4DV#DW001893

Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
EL1309	Firmware Update	0.3	86100-0R032	99	99

APPLICABLE WARRANTY

This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months
or 36,000 miles, whichever occurs first, from the vehicle's in-service date.

 Warranty application is limited to occurrence of the specified condition described in this bulletin.

Required Tools & Equipment

SPECIAL SERVICE TOOLS (SST)	PART NUMBER	QTY
USB Drive Firmware Update - DENSO*	01008-DENSO-13B	1

* Essential SST.

NOTE Additional SSTs may be ordered by calling 1-800-933-8335.

Repair Procedure

- 1. Plug the USB Drive SST into the USB slot located in the center console.
- 2. Press the Home button on the navigation screen. Figure 1.



化全容 的过去式和过去分词

Repair Procedure (Continued)

3. Press the Setup button ("wheel" mark on the bottom right of the screen).

Figure 2.

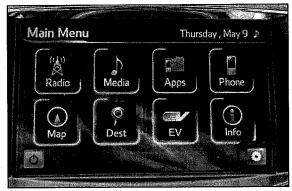


Figure 3.

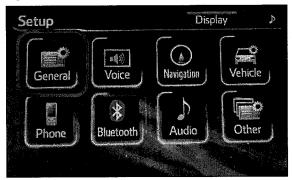


Figure 4.

General Settings	
Clock	
Language	English
Units	English
Веер	On
Keyboard Layout	QWERTY

4. Press General.

5. Scroll to the second page.

Repair Procedure (Continued)

6. Press Software Update.

Figure 5.

General Settings		
Auto Screen Change	On	
Delete Personal Data		NRAE.
Software Update		
Gracenote Database Update		
	11 A.	Save

7. Confirm the New software version is "VB503150." Then press *Update Software*.


Figure 6.

Software Update		<u>(</u>
Model ID : 1	11TSANNA-A	ZO3
	Current	New
Navigation :	VB503102	VB503150
Bluetooth :	21.210	21.210
Map Update Software :		Mulé
Update	: Software	

Repair Procedure (Continued)

8. Press Yes. The software update will take about 10 minutes.

Figure 7.

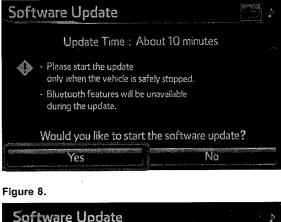

Sof	tware Update
	Copying new software
\diamond	Please do not eject or remove the update media.
	· Please do not turn the vehicle off.

9. The screen in Figure 9 will display when the download is complete.

Figure 9.



Repair Procedure (Continued)

10. Remove the USB Drive SST and place the vehicle Figure 10. in "IG-OFF" mode. Then place the vehicle in "IG-ON" mode to restart the system. The update will automatically commence once the system has restarted.



Figure 11.

It is necessary to update the software in order to use the navigation system in the future.
Updating software

11. Press Do Not Display This Message Again.





Repair Procedure (Continued)

- 12. Go back to the Software Update screen (follow steps 2 7).
- 13. Confirm the Current software version is now "VB503150."

Figure 13.

Software Update		r.
Model ID :	11TSANNA-AZ	03
	Current	New
Navigation :	VB503150	-
Bluetooth :	21.210	
Map Update Software :		

