



NUMBER: 05-001-13

GROUP: Brakes

DATE: January 26, 2013

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

THIS SERVICE BULLETIN IS ALSO BEING RELEASED AS RAPID RESPONSE TRANSMITTAL (RRT) 13-007. ALL APPLICABLE UN-SOLD RRT VIN's HAVE BEEN LOADED. TO VERIFY THAT THIS RRT SERVICE ACTION IS APPLICABLE TO THE UN-SOLD VEHICLE, USE VIP OR PERFORM A VIN SEARCH IN TECHCONNECT. FOR VEHICLES NOT INCLUDED IN THE RRT VIN LIST, APPLICATION OF THIS SERVICE BULLETIN TO SOLD UNITS IS BASED UPON THE CUSTOMER EXPERIENCING THE SYMPTOM/CONDITIONS. ALL REPAIRS ARE REIMBURSABLE WITHIN THE PROVISIONS OF WARRANTY.

SUBJECT:

Clicking Or Rubbing Noise From Rear Wheels

OVERVIEW:

Clicking or rubbing noise can be heard from the rear wheels at low speeds, primarily the left rear wheel.

MODELS:

2012 - 2013 (MK) Compass/Patriot (China Only)

NOTE: This Service Bulletin applies to vehicles with China Mainland Country Code (sales code 8BL).

DIAGNOSIS:

1. Drive vehicle with all electrical functions off, all windows open and the park brake engaged to the second click up.
2. Drive the vehicle forward 15 meters at a speed of no more than 8 KPH.
3. Drive the vehicle 15 meters in reverse at a speed of no more than 8 KPH.
4. Is there a clicking or rubbing noise coming from the rear wheel(s)?
 - a. Yes >> Perform the repair procedure [Step #1](#).
 - b. No >> This Service Bulletin does not apply, return vehicle to the customer or inventory.

PARTS REQUIRED:

Qty.	Part No.	Description
1 (AR)	68159650AB	Pin, Brake Shoe Hold Down

REPAIR PROCEDURE

1. Replace the rear parking brake shoe hold down pin(s) in the noisy wheel(s) by following the detailed service procedures available in DealerCONNECT/TechCONNECT, Refer To Group 05 > Brakes > Hydraulic/Mechanical > Rotor, Brake > Removal > REAR BRAKE ROTOR

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Amount
05-70-30-91	Inspect, Noisy Brakes (Skill Level = C; Training Level = 1)	0.2 Hrs.
05-70-30-92	Inspect, Noisy Brakes and Replace Pin (s) One Wheel. (Skill Level = C; Training Level = 1)	0.3 Hrs.
05-70-30-93	Inspect, Noisy Brakes and Replace Pin (s) Both Wheels. (Skill Level = C; Training Level = 1)	0.5 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------