



NUMBER: 08-040-13

GROUP: Electrical

DATE: May 24, 2013

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

SUBJECT:

Incorrect French And Spanish Translation In The Cluster For The Park Assist Options

OVERVIEW:

This Bulletin involves replacing the Instrument Panel Cluster (IPC).

MODELS:

2012 (RT) Town and Country/Caravan

NOTE: This bulletin applies to vehicles built on and before July 2, 2012 (MDH 0702XX) equipped with Parksense Rear Park Assist System (sales code XAA) and Vehicle Information Center (sales code LAZ).

SYMPTOM/CONDITION:

A customer may note that some of the translation for French and Spanish is incorrect in the Electronic Vehicle Information Center (EVIC) when trying to change Personal Settings for park assist. All park assist functions will operate properly.

DIAGNOSIS:

If the customer describes the symptom, perform the Repair Procedure.

PARTS REQUIRED:

Qty.	Part No.	Description
1 (AR)	68055731AH	Instrument Cluster, (Canada 200 KMH)
1 (AR)	68055679AH	Instrument Cluster, (Dodge US)
1 (AR)	68055682AH	Instrument Cluster, (Chrysler US)
1 (AR)	68055689AH	Instrument Cluster, (International, Canada, Mexico - Gas, 220 KMH)
1 (AR)	68055695AI	Instrument Cluster, (International Diesel)

NOTE: All clusters with be ordered through the Exchange center.

REPAIR PROCEDURE:

1. Replace the Instrument Cluster per TechCONNECT, 08 - Electrical/8J - Instrument Cluster/Removal/Installation.

NOTE: Certain indicators in this instrument cluster are automatically configured. This feature allows those indicators to be activated or deactivated for compatibility with certain optional equipment. If a problem is noted that involves improper illumination of an indicator, disconnect and isolate the battery negative cable. After about five minutes, reconnect the battery negative cable and turn the ignition switch to the ON position. The instrument cluster should automatically relearn the equipment in the vehicle and properly configure the configurable indicators accordingly

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Amount
08-45-10-96	Module, Cab Compartment Node (CCN), Replace (2 - Skilled).	2.4 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------