



# Service Bulletin

File in Section: -

Bulletin No.: PIP5123

Date: May, 2013

## PRELIMINARY INFORMATION

**Subject:** SES Lamp On With DTC P2270

**Models:** 2013 Chevrolet Silverado  
2013 GMC Sierra  
Built with 4.8L 5.3L 6.0L RPO L20 LC9 LMG L96


The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

### Condition/Concern

Concern of DTC P2270 setting along with any of the following codes P0140, P0139, P0138, P0137, P013A, P013B on vehicles built at the Fort Wayne assembly plant during February 2013.

### Recommendation/Instructions

Check connector X131 for a bent terminal F as indicated in the attached PIC and repair per SI procedures.

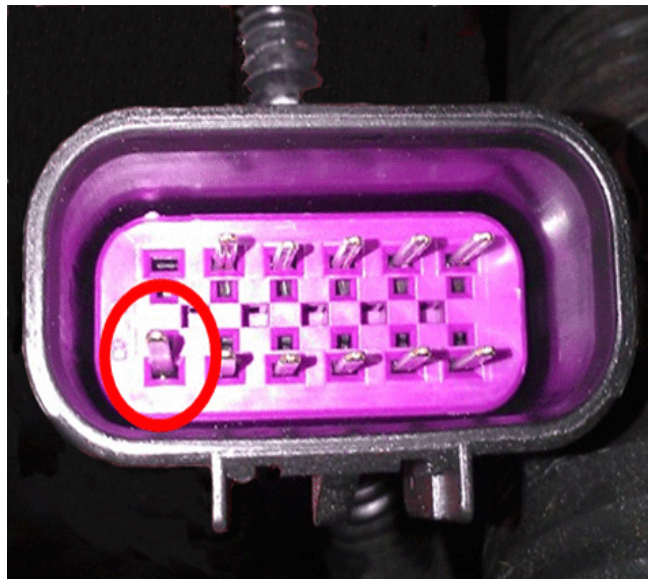

3454867

If no connector issue is found, follow SI diagnostics.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.