

NUMBER: 08-071-13

GROUP: Electrical

DATE: September 11, 2013

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

THIS SERVICE BULLETIN IS ALSO BEING RELEASED AS RAPID RESPONSE TRANSMITTAL 13-067. ALL APPLICABLE SOLD AND UN-SOLD VIN'S HAVE BEEN LOADED. TO VERIFY THAT THIS SERVICE ACTION IS APPLICABLE TO THE VEHICLE, USE VIP OR PERFORM A VIN SEARCH IN TECHCONNECT. ALL REPAIRS ARE REIMBURSABLE WITHIN THE PROVISIONS OF WARRANTY.

THE WITECH SOFTWARE LEVEL MUST BE AT RELEASE 14.01 OR HIGHER TO PERFORM THIS PROCEDURE.

SUBJECT:

Install Correct Navigation Radio RB6 Hawaii Only

OVERVIEW:

This Bulletin involves installing the correct navigation radio and GPS antenna.

MODELS:

2013

(PF)

DART (Hawaii vehicles only)

NOTE: This bulletin applies to vehicles built on or after March 22, 2013 (MDH 0322XX) on or before May 28, 2013 (MDH 0528XX) with sales code 912, Hawaii Sold to State.

SYMPTOM/CONDITION:

A customer may note that the Monroney label show that the vehicle should have a Navigation radio and the vehicle doesn't have this feature.

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RRT VIN list, perform the repair. For all other customers that describe the symptom/condition, perform the Repair Procedure.

PARTS REQUIRED:

Qty.	Part No.	Description	
1 (AR)	05064186AA	GPS antenna	
1 (AR)	06101946	06101946 Antenna, Fastener	
1 (AR)	05091968AD	Radio (RB6)	

REPAIR PROCEDURE:

1. Remove the radio/TGW. Follow the procedure in TechConnect,08 - Electrical/8E - Electronic Control Modules/MODULE, Telematics Gateway/Removal

NOTE: The Radio and Telematics Gateway (TGW) module are one in the same part.

The TGW controls all radio functions.

2. Install a GPS antenna. Follow the installation procedure in TechConnect, 08 - Electrical/8T - Navigation/Telecommunication/Navigation System/ANTENNA, Navigation/Installation.

NOTE: Before installing the new radio, write down the serial number of the radio.

This will be needed when accessing the radios anti-theft code. Follow service bulletin 08-011-12 for the procedure to get this code.

- 3. Install the radio/TGW. Follow the procedure in TechConnect,08 Electrical/8E Electronic Control Modules/MODULE, Telematics Gateway/Installation.
- 4. Using a Scan Tool (wiTECH) with the appropriate, Vehicle Preparations, Perform a Proxy relearn.
- 5. Clear any DTC's that may have been set in other modules due to this repair procedures wiTECH application will automatically present all DTCs after the flash and allow the tech to clear them.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Amount
08-60-02-D3	Radio/Telematics Gateway Module (TGW), GPS antenna, replace, (1 - Semi-Skilled)	1.1 Hrs.

FAILURE CODE:

ZZ	Service Action	
----	----------------	--