



# Service Bulletin

File in Section: -

Bulletin No.: PIP5147A

Date: September, 2013

## PRELIMINARY INFORMATION

**Subject:** SES Lamp P0300 P0351 - P0358

**Models:** 2014 Chevrolet Silverado 1500  
2014 GMC Sierra 1500  
Built with RPOs 4.3L 5.3L L83 LV3

This PI was superseded to add a picture of the concern. Please discard PIP5147.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

### Condition/Concern

If the vehicle has a misfire with any of the following codes:

P0351-P0358, P2300, P2301, P2303, P2304, P2306, P2307, P2309, P2310, P2312, P2313, P2315, P2316, P2318, P2319, P2321, or P2322

### Recommendation/Instructions

Inspect the coil connectors for a clear water and/or a discolored connector.

Picture of a coil with the concern:



3620542

If this is found inspect the pigtail for pin drag or loose terminals (repair as needed).

Swap the coil to a known good location.

If the concern follows the coil replace the coil or coils with the concern and add dielectric grease to the connection.

# Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
4020070	Ignition Coil Replacement	Use Published Labor Operation Time

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.