



# Service Bulletin

File in Section: -

Bulletin No.: PIP5141B

Date: November, 2013

## PRELIMINARY INFORMATION

**Subject:** SES Lamp P06DD Set

**Models:** 2014 Chevrolet Corvette  
2014 Chevrolet Silverado 1500  
2014 GMC Sierra 1500  
Built with RPOs 4.3L 5.3L 6.2L L83 L86 LT1 LV3

**This PI was superseded to update the diagnostic test and the model list. Please discard PIP5141A.**

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

### Condition/Concern

A vehicle may set a P06DD code with no drivability concerns.

### Recommendation/Instructions

If P06DA, P06DB, and P06DC are not set with the P06DD, gather the following information.

1. Run the engine to 100 c or 214 degrees F
2. Check the oil pressure at idle with GDS
3. Run the engine at 1100 rpm for 45 seconds and record the oil pressure.
4. Run the engine at 3500 rpm for 45 seconds and record the oil pressure.
5. Perform the following with GDS with the engine at 100 c or 214 f
  - 5.1. Run the engine at 1400 rpm. Command the OCV on and off 10 times. On the 11th time, record the reading on and off.
  - 5.2. Run the engine at 2500 rpm. Command the OCV on and off 10 times. On the 11th time, record the reading on and off.

Record all readings then contact GM TAC.

### Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
4066070	Oil Pump testing and replacement	Use Published Labor Operation Time

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.