



Service Bulletin

File in Section: -

Bulletin No.: PIP5123A

Date: June, 2013

PRELIMINARY INFORMATION

Subject: SES Lamp On With DTC P2270

Models: 2013 Chevrolet Silverado
2013 GMC Sierra
Built with 4.8L 5.3L 6.0L RPO L20 LC9 LMG L96

This PI was superseded to add warranty information. Please discard PIP5123.


The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

Concern of DTC P2270 setting along with any of the following codes P0140, P0139, P0138, P0137, P013A, P013B on vehicles built at the Fort Wayne assembly plant during February 2013.

Recommendation/Instructions

Check connector X131 for a bent terminal F as indicated in the attached PIC and repair per SI procedures.

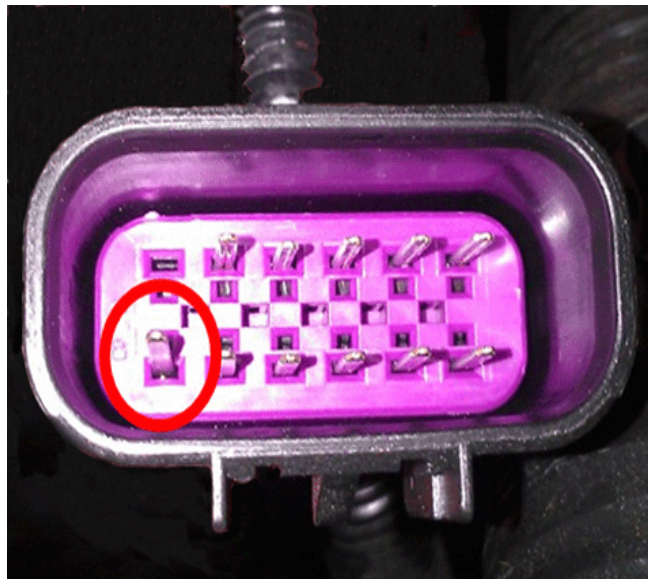

3454867

If no connector issue is found, follow SI diagnostics.

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin 10-00-89-005 for warranty information on wire/connector repairs.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.