



Service Bulletin

File in Section: -

Bulletin No.: PIP5119

Date: May, 2013

PRELIMINARY INFORMATION

Subject: DTCs P0088 And P128E Setting After Fuel System Or Engine Repair

Models: 2010 - 2013 Chevrolet Express
2010 - 2013 GMC Savana
2011 - 2013 Chevrolet Silverado
2011 - 2013 GMC Sierra
Equipped with the 6.6L Duramax Diesel RPO codes LGH and LML

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

DTCs P0088 and P128E sets after a fuel system or engine repair.

The engine may run rough and fuel knock at idle with a fuel pressure of 200 mpa, or 29000 psi.

Recommendation/Instructions

Check for FRP regulator 1 and 2 connectors that may have been swapped during a fuel system or engine repair.

Be sure to follow SI2000 to determine the circuit identification for FRP 1 and 2 regulators and repair as necessary.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.