



NUMBER: 18-024-13
GROUP: Vehicle Performance
DATE: June 25, 2013

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

HELP USING THE wiTECH DIAGNOSTIC APPLICATION FOR FLASHING AN ECU IS AVAILABLE BY SELECTING “HELP” THEN “HELP CONTENTS” AT THE TOP OF THE wiTECH DIAGNOSTIC APPLICATION WINDOW.

THE wiTECH SOFTWARE LEVEL MUST BE AT RELEASE 13.04 OR HIGHER TO PERFORM THIS PROCEDURE.

SUBJECT:

Flash: MIL Illumination P0830- Clutch Upstop Switch Rationality or P0456- Evap System Small Leak

OVERVIEW:

This bulletin involves selectively erasing and reprogramming the Powertrain Control Module (PCM) with new software.

MODELS:

2012 - 2013 (JK) Wrangler

NOTE: This bulletin applies to vehicles equipped with a 3.6L engine (sales code ERB) built on or before June 10, 2013 (MDH 0610XX).

SYMPTOM/CONDITION:

A small number of customers may experience a Malfunction Indicator Lamp (MIL) illumination. Upon further investigation the Technician may find that the following Diagnostic Trouble Codes have been set:

- P0830- Clutch Upstop Switch Rationality
- P0456 - Evap System Small Leak

NOTE: The correction for Diagnostic Trouble Code P0456 only applies to 2013 Model Year vehicles.

DIAGNOSIS:

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in TechCONNECT, verify all engine systems are functioning as designed. If DTC's other than the one listed above are present record them on the repair order and repair as necessary before proceeding further with this bulletin.

If the customer describe the symptom/condition or if the technician finds the DTCs, perform the Repair Procedure.

PARTS REQUIRED:

Qty.	Part No.	Description
1	04275086AB	Label, Authorized Modification

REPAIR PROCEDURE:

NOTE: Install a battery charger to ensure battery voltage does not drop below 13.2 volts. Do not allow the charging voltage to climb above 13.5 volts during the flash process.

NOTE: If this flash process is interrupted/aborted, the flash should be restarted.

1. Reprogram the PCM with the latest software. Follow the detailed service procedures available in DealerCONNECT/TechCONNECT, Refer To Group 8 - Electrical > Electronic Control Modules - Service Information > Module - Powertrain Control > Standard Procedures > PCM/ECM Programming.
2. **After PCM reprogramming, the following must be performed:**clear any DTC's that may have been set in other modules due to reprogramming. The wiTECH application will automatically present all DTCs after the flash and allow the tech to clear them.
3. Type the necessary information on the "Authorized Modification Label" and attach it near the VECI label.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
18-19-06-U9	Module, Powertrain Control (PCM) - Reprogram (1 - Semi-Skilled)	8 - Engine Performance	0.2 Hrs.

FAILURE CODE:

FM	Flash Module
----	--------------