



# Service Bulletin

File in Section: -

Bulletin No.: PIC5933

Date: November, 2013

## PRELIMINARY INFORMATION

**Subject:** Rear Fascia Not Flush To Rear Quarter Panel

**Models:** 2013 - 2014 Chevrolet Malibu

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.


### Condition/Concern

A customer may indicate the rear fascia does not fit flush with rear quarter panel on either side of the vehicle. Build tolerance may cause a condition in which the distance between the rear fascia bracket and the quarter panel is too tight. This may not allow the rear bumper fascia to seat into the bracket.

### Recommendation/Instructions

Remove the rear fascia following the "Rear Bumper Fascia Replacement" procedure in Service Information.

Using the image below as a guide, remove the seven (7) indicated standoffs from the Rear Bumper Fascia Outer Guide on the effected side. Once the standoffs have been removed, reinstall the fascia and confirm proper fit.

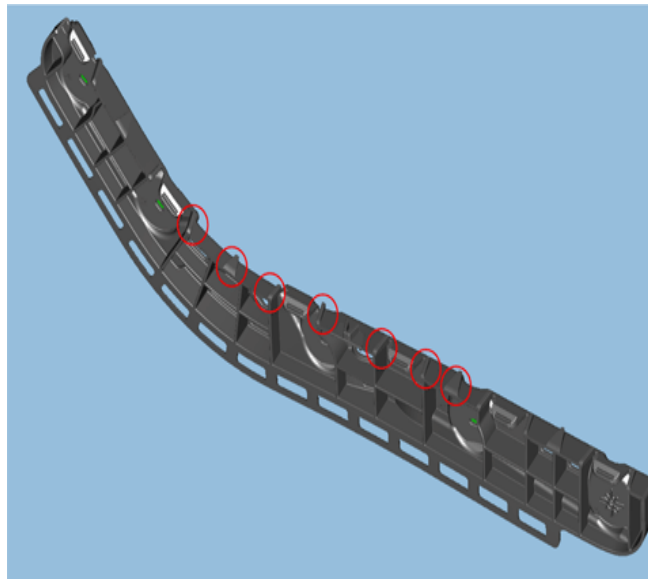

3649283

### Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
*1480158	Modify Rear Bumper Fascia Outer Guide	1.3 hr
* This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.		

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.