



# Service Bulletin

File in Section: -

Bulletin No.: PIC5886

Date: July, 2013

## PRELIMINARY INFORMATION

**Subject:** Hood To Fascia Adjustment Procedure

**Models:** 2012 - 2013 Chevrolet Camaro ZL1

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

### Condition/Concern


There may be a fit concern of the hood-to-front fascia being too high or too low to each other.

### Recommendation/Instructions

Use the following inspections and adjustments, as applicable, to improve the hood to front fascia fit / appearance. Only perform the adjustments necessary to achieve the appropriate specs listed below.




3530644

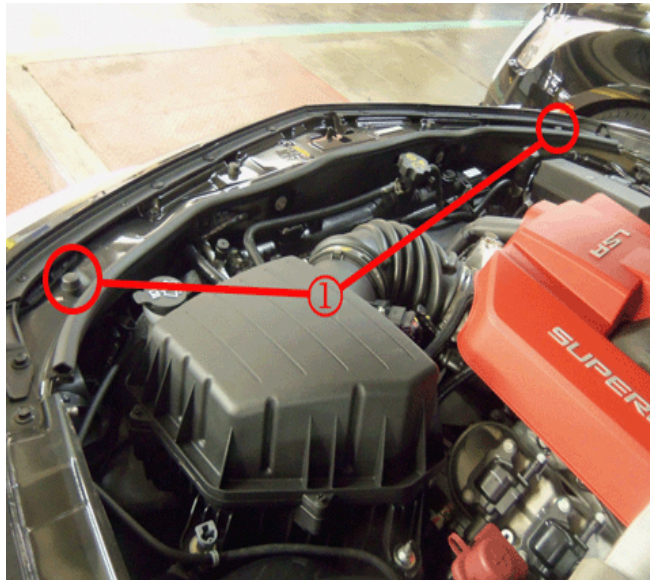

3530646

1. Verify the hood is flush to  $-0.5\text{mm}$  low to the fenders (1). This can be done by adjusting the hood bumpers (1).

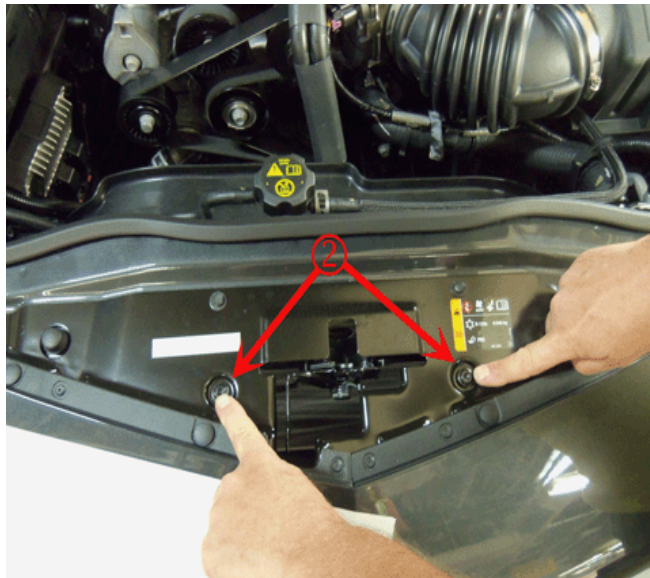

3530647

2. Verify the hood is flush to  $-1.00\text{ mm}$  low to the fascia (2). This can be done by adjusting the Stealth Plate (2) higher or lower.



3530648

- Localized raising of the fascia can be achieved by adding a spacer (PN 22739732) between the fascia and bracket at the applicable push pin locations.



3530650

- Extra adjustment of the fascia can also be achieved by loosening this screw (4) and “pulling” on the fascia. Tighten the screw before releasing the fascia.

## Parts Information

Part Number	Description	Qty
22739732	Spacer	As Needed

## Warranty Information

The correction for this concern may be one of several repairs described above. For vehicles repaired under warranty, please use the appropriate warranty labor operation based on the actual cause and repair.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.