



# Service Bulletin

File in Section: -

Bulletin No.: PIC5885

Date: July, 2013

## PRELIMINARY INFORMATION

**Subject:** Folding Top Leans To One Side During Top Cycle

**Models:** 2011 - 2013 Chevrolet Camaro Convertible

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

### Condition/Concern

A customer may comment the convertible folding top leans to one side when opening or closing the roof. This condition could be caused by a ball socket that has separated from either the left or right hydraulic cylinder.

### Recommendation/Instructions

Inspect the hydraulic cylinders for proper attachment to the folding top frame assembly. If the cylinder has separated from the folding top frame, replace the retainer and reinstall the cylinder to the frame assembly.

### Parts Information

Part Number	Description	Qty
11611829	Clip	As Needed

### Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
*6080028	Replace Folding Top Cylinder Retainer / Clip	0.5 hr
* This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.		

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.