



# Service Bulletin

File in Section: -

Bulletin No.: PIC5861

Date: July, 2013

## PRELIMINARY INFORMATION

**Subject:** SES MIL DTC P0442

**Models:** 2010 - 2012 Buick LaCrosse  
Equipped with 3.0L (RPO LF1) or 3.6L (RPO LLT)

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.


### Condition/Concern

SES MIL illuminated with a DTC P0442 setting.


### Recommendation/Instructions

Visually inspect evaporative pipe for contact with the throttle body. If contact is present, replace the evaporative pipe as needed and secure to eliminate future contact. Clear DTCs.

**Note:** The new evaporative pipe will have a conduit installed in the area of concern of the original pipe. Reference photos below.

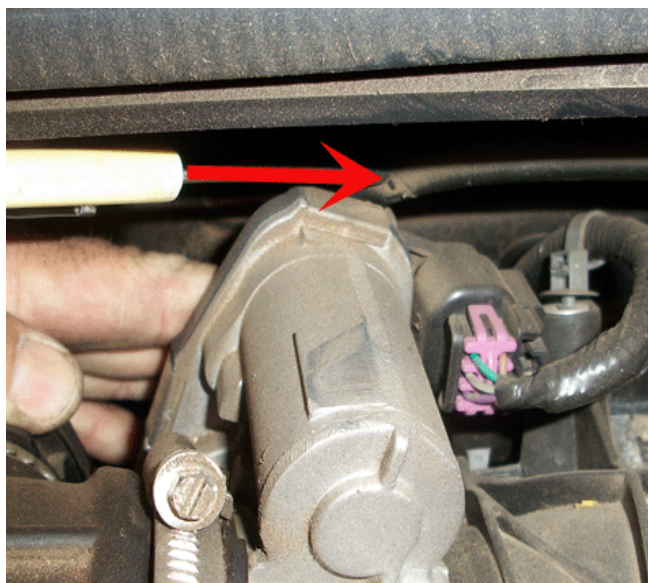

3436210

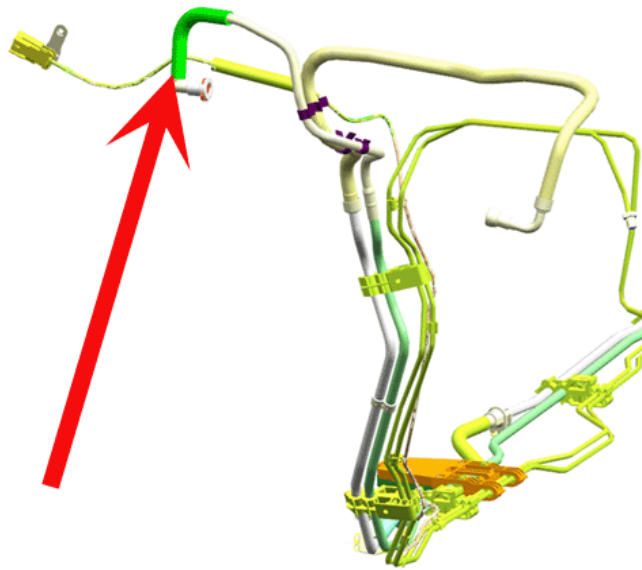

3532961

## Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
4025730	Evaporative Emission Canister Purge Pipe Replacement	Use Published Labor Operation Time

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.