



Service Bulletin

File in Section: -

Bulletin No.: PIC5851A

Date: December, 2013

PRELIMINARY INFORMATION

Subject: Diagnostic Tip - USB Port Inoperative Using Multi Media Interface Tester (MIT)

Models: 2013 Cadillac ATS
Equipped with Radio RPO RAO (without UA3)

2014 Cadillac ATS
2014 Chevrolet Impala, Silverado 1500
2014 GMC Sierra 1500
Equipped with Radio RPO IO3

This PI was superseded to update model list. Please discard PIC5851.

Condition/Concern

USB port inoperative using Multi-Media Interface Tester (MIT)

MIT Information

The Multi-Media Interface Tester (MIT) Kit # EL-50334-100

Handheld tool in the kit labeled EL-50334-20

Recommendation/Instructions

Currently, the Multi-Media Interface Tester (MIT) should NOT be used on the above listed vehicles with a base radio for testing USB function. If the MIT is used to test USB function, the USB port may become inoperative. For the port to function again, the ignition will need to be cycled off for 10 minutes OR the battery will need to be disconnected then reconnected. The MIT can be used to test Bluetooth streaming and AUX input "ONLY" if the MIT is powered from the vehicle's auxiliary 12 volt outlet.

Engineering is currently aware of the concern and this PI will be updated when further information is available.

ADDITIONAL SI KEYWORDS:

audio auxiliary B1025 B124B B124C B1135 B2485