

TECHNICAL BULLETIN  
JTBO0302NAS1  
25 OCT 2013



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

**SECTION: 501-05**

Sun Visor Delamination

**AFFECTED VEHICLE RANGE:**

**XF (X250)**

**Model Year:** 2009 Onwards  
**VIN:** R00001 Onwards

**XJ Range (X351)**

**Model Year:** 2010 Onwards  
**VIN:** V00047 Onwards

**XK Range (X150)**

**Model Year:** 2007 Onwards  
**VIN:** B00001 Onwards

**MARKETS:**

NAS

**CONDITION SUMMARY:**

**Situation:** The sun visor, local to the vanity pack, may delaminate.

**Cause:** This may be caused by the visor sock not being retained under the vanity pack and when folding down the sun visor the cloth may be rolled out of the vanity overlap over time.

**Action:** Should a customer express this concern, follow the Service Instruction outlined below.

**PARTS:**

C2Z27681      Tape Kit      Quantity: 1

**TOOLS:**

No Tools Required

**WARRANTY:**

 **NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIX to obtain the latest repair time.**

 **NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.**


DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Sun visor delamination - Repair	<b>05.10.20</b>	0.2	31	C2Z2415XXX

 **NOTE: Normal Warranty policies and procedures apply.**

**SERVICE INSTRUCTION:**


1.  **NOTE: Right sun visor shown; left sun visor similar.**

Using a suitable tool, release the retaining clips and remove the sun visor vanity mirror from the sun visor.

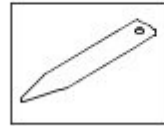


E150926

2. Install double-sided tape as shown.

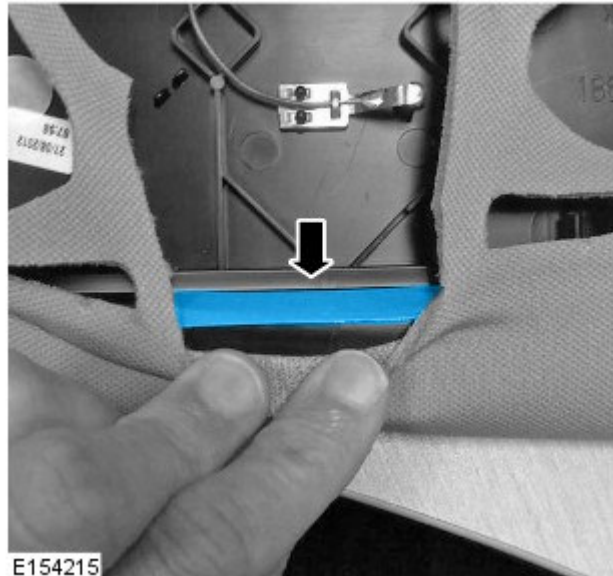



E154215

3. Remove the tape protector paper.

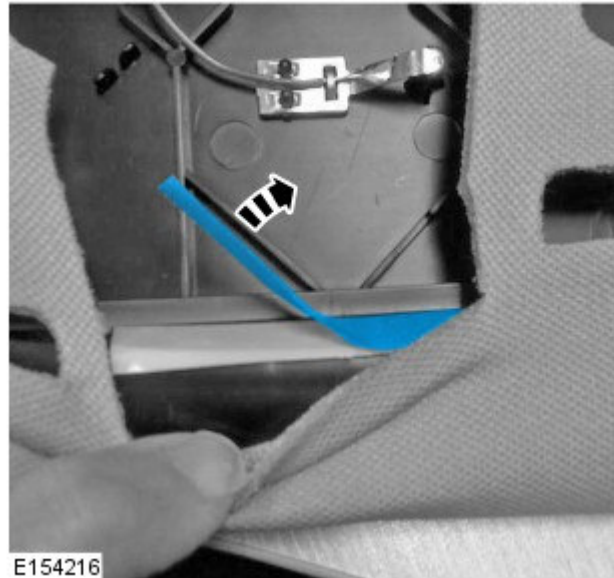

4. Position and press into place the fabric onto the double-sided tape.

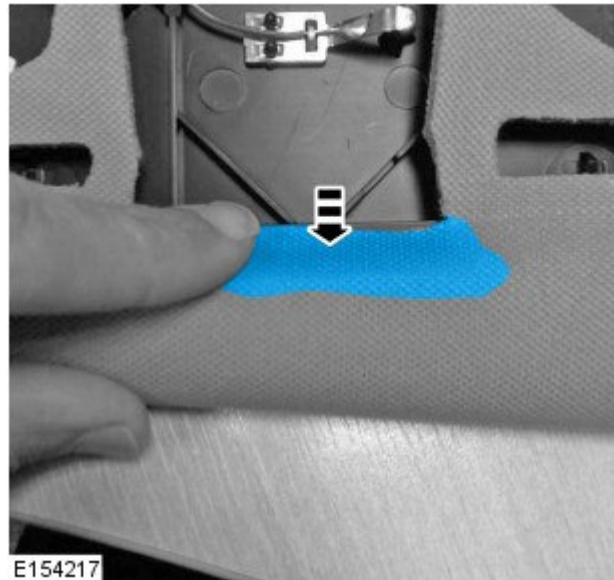

5.  **CAUTION: Do not use excessive force to install the component.**



**NOTE: Right sun visor shown; left sun visor similar.**

Install the sun visor vanity mirror by pressing firmly against the areas indicated until an audible 'click' is heard.



E150927