

TECHNICAL BULLETIN
 UPS3013-1bNAS1
 02 JUL 2013



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 413-01

Update Prior to Sale: Instrument Cluster Software Update

AFFECTED VEHICLE RANGE:

F-TYPE (X152)

Model Year:	2014
VIN:	K00317-K00734

MARKETS:

NAS

CONDITION SUMMARY:

Situation: The date format on the Touch Screen (TS) System Settings / Clock Adjust menu may be unable to be changed from 'DD/MM/YYYY' to 'MM/DD/YYYY' due to a software issue within the Instrument Cluster (IC).



NOTE: The date will only be displayed when accessing the Touch Screen (TS) Systems Settings / Clock Adjust menu.

Action: Retailers are required to **HOLD** all affected vehicles within the listed VIN range that are in their control and refrain from releasing the vehicles for new or used vehicle sale pending completion of the rework action detailed in this Technical Bulletin. Unsold vehicles should have this performed as part of the Pre-Delivery Inspection (PDI) process. Affected vehicles already in the hands of customers should be updated at the next available opportunity.

PARTS:

No parts required

SPECIAL TOOLS:



NOTE: This document is an 'Active Bulletin' that will display a functional programming shortcut if accessed within a diagnostic session using SDD.

IDS with latest IDS-DVD and Calibration File; first available on DVD134.05 V.137

Jaguar Land Rover-approved Midtronics battery power supply

WARRANTY:



NOTE: Check DDW to ensure that the vehicle is affected by this program prior to undertaking any rework action. Repair procedures are under constant review, and therefore times / prices are subject to change; those quoted here must be taken as guidance only. Refer to the Repair Times Searcher (RTS) on

TOPIX to obtain the latest repair time. At the time of confirming a booking for vehicle repair, ensure that all outstanding Service Actions are identified to ensure the correct parts are available and adequate workshop time is allocated for repairs to be completed at one visit.

Warranty claims must be submitted quoting Program Code '**K181**' together with the relevant Option Code from the table. The SRO and part information listed have been included for information only. The Option Code(s) that allows for the drive in / drive out allowance can only be claimed if the vehicle is brought back into the workshop for this action alone to be undertaken.

This program is valid for a limited time only. Warranty claims with a repair date prior to the **14 December 2013** closure date must be submitted for payment within 30 calendar days of completion of the repair.

PROGRAM CODE	OPTION CODE	DESCRIPTION	SRO	TIME (HOURS)	PARTS	QTY. / VALUE
K181	B	Configure Existing Instrument Cluster	86.99.75	0.30	-	-
K181	C	Configure Existing Instrument Cluster Drive in/drive out	86.99.75 10.10.10	0.30 0.10	-	-



NOTE: Normal Warranty policies and procedures apply

SERVICE INSTRUCTION:

1.  **CAUTION: Ensure all ignition 'ON' / ignition 'OFF' requests are carried out; failure to perform these steps may cause damage to control modules in the vehicle.**



CAUTION: A Jaguar Land Rover-approved Midtronics battery power supply must be connected to the vehicle battery during IDS / SDD diagnosis / module programming.



NOTE: IDS must be loaded with DVD134.05 v.137 or later.

Connect the Jaguar Land Rover-approved Midtronics battery power supply to the vehicle battery.

2. Turn ignition 'ON' (engine not running).
3. Connect the Integrated Diagnostic System (IDS) to the vehicle and begin a new Symptom Driven Diagnostics (SDD) session.
4. Follow the on-screen prompts, allowing SDD to read the VIN and identify the vehicle and initiating the data collect sequence.
5. Select 'Diagnosis' from the Session Type screen.
6. Select the 'Selected Symptoms' tab, and then select the following:
 - Electrical > Instruments > Warning lamps
7. Select the 'Extras' tab.
8. From the Recommendations tab, select **Run** to perform the 'Configure existing module – Instrument cluster control module' option.
9. Follow all on-screen instructions to complete this task.
10. Exit the current session.
11. Disconnect the IDS and the battery power supply from the vehicle.