

TECHNICAL BULLETIN  
JTB00191NAS3  
06 SEP 2013



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

**This reissue replaces all previous versions. Please destroy all previous versions. Only refer to the electronic version of this Technical Bulletin in TOPIx.**

**SECTION: 501-12**

Glove Compartment Lid Not Damped When Opening

**AFFECTED VEHICLE RANGE:**

**XK Range (X150)**

**Model Year:** 2007-2013

**VIN:** B00001-B51978

**MARKETS:**

NAS

**CONDITION SUMMARY:**

**Situation:** The glove compartment lid may not be damped when opening.

**Cause:** This may be caused by the glove compartment lid damper cord retaining tab coming away from the glove compartment housing.

**Action:** Should a customer express this concern, follow the Service Instruction outlined below.

**PARTS:**



**NOTE: The cotter / split pin (2mm x approx 30mm) must be locally sourced.**

-

2mm X 30mm cotter / split pin

Quantity: 1 (locally sourced)

**TOOLS:**

No Tools Required

**WARRANTY:**



**NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.**



**NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.**


DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Glove compartment damper arm - Repair	<b>76.95.64</b>	0.3	42	C2P16747SEP



**NOTE: Normal Warranty policies and procedures apply.**

**SERVICE INSTRUCTION:**


1. Remove the glove compartment (see TOPIx Workshop Manual, Section 501-12).
2. Using a suitable 2mm drill, drill a hole (shown in the shaded area) through the glove compartment damper arm.

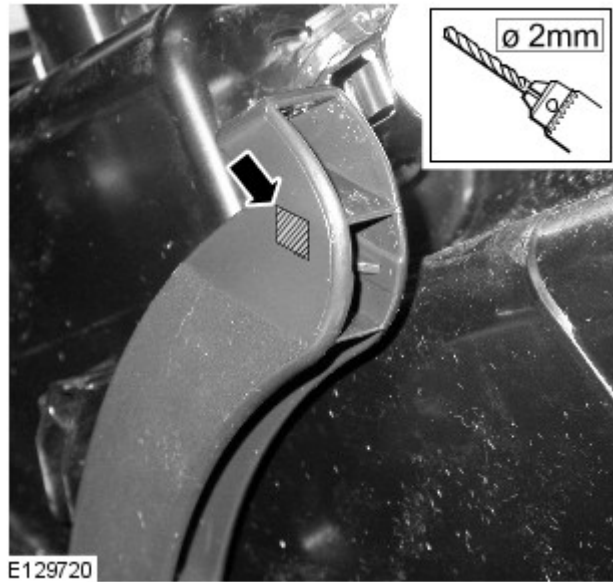

3. Install the glove compartment lid damper cord looped end into the damper arm ('1').
  - Install the cotter / split pin into the drilled hole and through the damper cord looped end ('2').



4. Fold the protruding ends of the cotter / split pin.

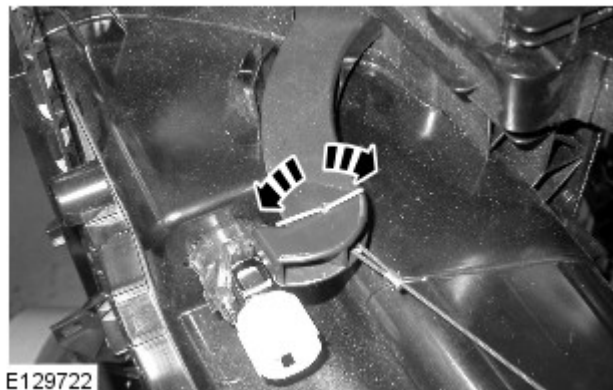

5. Install the glove compartment (see TOPIx Workshop Manual, Section 501-12).