

42 Cracking noises from rear of vehicle

42 13 19 2029953/3 September 24, 2013. Supersedes Technical Service Bulletin Group 42 number 12-15 dated October 12, 2012 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment	
A6 / A7	2011 - 2014	All	All	

Condition

REVISION HISTORY					
Revision Date		Purpose			
3	-	Revised header data (Updated VIN range) Revised title Revised Production Solution (Added information)			
2	10/12/2012	Revised header data			
1	6/28/2012	Original publication			

Cracking or clicking noises are heard from the rear of the vehicle in the C pillar area when it is driven over bumps or rough roads.

Technical Background

The noise comes from the upper shock absorber mounting.

Production Solution

Optimized damper mounting gradually introduced in production.

Service

- 1. Determine the location of the noise (left rear or right rear) with a test drive.
- 2. Swap rear shock assemblies (with mounting) from right to left:
 - If the noise changes sides, replace the affected shock absorber mounting.
 - If the noise does *not* change sides, continue diagnosis.

© 2013 Audi of America, Inc.

Page 1 of 2

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Technical Service Bulletin

Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.					
Service Number:	4295					
Damage Code:	0020					
Labor Operations:	2 shock absorbers remove and reinstall	4293 2000	130 TU			
	Shock absorber replace (use this labor operation for replacement of affected shock absorber mounting)	4293 5550	20 TU			
Diagnostic Time:	Road test prior to service procedure	0121 0002	10 TU			
	Road test after service procedure	0121 0004	10 TU			
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online	aler's discretion and Audi Warranty Online for DADP allowance details)				
Claim Comment:	As per TSB #2029953/3					

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual.* Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Part Number	Part Description	Quantity
4G0513353	Rear shock absorber mounting	1 or 2

Additional Information

All parts and service references provided in this TSB (2029953) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

© 2013 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.