

# Technical Service Bulletin

#### 55 Hands free trunk release intermittently inoperative

55 13 28 2031273/2 February 27, 2013. Supersedes Technical Service Bulletin Group 55 number 12-26 dated October 23, 2012 for reasons listed below.

| Model(s) | Year        | VIN Range       | Vehicle-Specific Equipment            |
|----------|-------------|-----------------|---------------------------------------|
| A8       | 2012        | 017050 - 999999 | Hands free trunk release              |
|          | 2013 - 2014 | All             | (Advanced key, PR 4I3, from CW 45/11) |

### **Condition**

| REVISION HISTORY |            |   |  |  |
|------------------|------------|---|--|--|
| Revision         | Date       | Purpose   |  |  |
| 2                | -          | Revised Technical Background (additional information) |  |  |
| 1                | 10/23/2012 | Original publication                                  |  |  |

The movement-activated rear lid opening (also known as "Hands-free trunk release") sporadically is inoperative. This feature is installed on all A8 vehicles with Audi advanced key (PR No. 4I3) from CW 45/2011 production.

# Audi

# Technical Service Bulletin

## **Technical Background**

#### Hands-free trunk release system, operating parameters

- 1. The system is only active when the ignition is switched off.
- 2. The function works via the advanced key system. Operation may temporarily be affected from other signal transmitters. Examples include additional remote keys or a cell phone in the same pocket as the vehicle key or interference from nearby transmitters of the same frequency (TV transmitters, wireless headphones, other vehicle remote controls, etc.).
- 3. The optimal movement is a straight forward *and* backward motion of the foot under the rear bumper (Figure 1). Other movements, such as from left to right, may not be recognized by the system.



Figure 1. Optimal movement for foot recognition.

4. The optimal area for detecting foot movement is shown in the illustration; areas to the left and right may not recognize the movement (Figure 2).



Figure 2. Optimal area for foot recognition.

5. When performing the foot movement you should stand at least eight inches behind the vehicle. If you are closer than eight inches to the vehicle, your foot movement may not be recognized.

# Audi

## Technical Service Bulletin

- 6. The system can detect moving water underneath the vehicle. If moving water is detected, the hands-free trunk release is deactivated for safety reasons for about a minute. This also prevents opening the trunk unnecessarily (for example, in a car wash or during heavy rain). The moving water detection may also be activated with movements other than those described in point 3.
- 7. Dirt and salt on the rear bumper and rear underbody of the vehicle where the sensor cables are installed can affect the electric field which recognizes the foot movement. This area must be clean for proper system operation.
- 8. Immediately after closing the trunk lid, the hands-free trunk release is disabled for a few seconds.

### **Production Solution**

Not applicable.

### **Service**

Explain the system behavior and concept related-restrictions to the customer.

## **Warranty**

This TSB is informational only and not applicable to any Audi warranty.

### **Additional Information**

More information on this system can be found in the following resources:

 Owners Manual insert: Owner's Manual Model Year 2013 Audi A8 Movement-activated rear lid opening (Part #: MY13A8OMINSUS)

All parts and service references provided in this TSB are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.