

Technical Service Bulletin

94 PSS LED Daytime Running Lights (DRL) Flickering or Intensity Change

94 13 07 2033012/1 February 15, 2013.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q5	2010 - 2012	All	Xenon headlights with LED DRLs

Condition

Customer may report:

- One Daytime Running Light (DRL) intermittently flickers.
- One Daytime Running Light (DRL) intermittently lights up with more intensity then dims back to normal.

The headlight beams still function normally.

Technical Background

The LED DRL control unit's PWM output reacts to an intermittent system voltage change, causing the LED to flicker or change intensity. DTCs will **not** be logged in the vehicle electrical system control module, J519 (09). The customer complaint can only be sporadically reproduced.

Production Solution

New LED DRL control units will be released for Audi Q5s through Model Year 2012. The affected part number is **8R0907472A**.

© 2013 Audi of America, Inc.

Page 1 of 2

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

Technical Service Bulletin



Service

Do not replace the LED DRL control unit until a revised part is available.

- 1. Explain to the customer that a solution is forthcoming and that no repairs are necessary at this point. Do not replace any components for this condition since this will not resolve the customer's concern.
- 2. Create a PSS record in the PSS application via the hyperlink in Accessaudi.com (Figure 1) or Technical Assistance page in Elsa (Figure 2).



Figure 1. Related Sites section on Accessaudi.com landing page

			Opene Tachute		
Annes Cale Deverte ant BAR	Cose Randor	-		Real for	-
			faculated	Tableta	
Annes Cale Tara parte surgitariates	Cree Randor	-		Build fair	Refer
		Criteral Meril Tackets			
Access Calls	Case Norther		-	Multi fee	944
bearing Att han					
* Ville is not populated					
Read of Operations					
Munday New Yorkay Kill AM to 188 PM (1			Pullare the lock believe to Pending Service Solutions		
from monthly every Monthly:			Panillog Sature Salaton		
1007011-33070411					

Figure 2. Technical Assistance page

Additional Information

All parts and service references provided in this TSB are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

^{© 2013} Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.