

## Field campaign

Topic	Mulsanne side view camera control module (SC12/15)
Market area	Worldwide Bentley (1WBE)
Brand	Bentley
Transaction No.	2030874/3
Campaign number	E775
Note	E775
Type	
US code	

## Vehicle data

### Mulsanne

### Sales types

Type	MY	Brand	Designation	Engine code	Gearbox code	Final drive code
3Y2*	2012	E		*	*	*

### Chassis numbers

Manufacturer	Filler	Type	Filler	MY	Factory	From	To	Prod from	Prod to
SCB	*	3Y	*	C	C	016181	017043		
SCB	*	ZH	*	C	C	016181	017043		

## Documents

Document name
master.xml
sideviewcamera.doc

## Notes

### Technical background

In January 2012 a TPI was released which instructed Dealers to remove where fitted the side view camera control module as a potential fault was identified with the original part. The latest specification side view camera control module is now available for all Bentley Mulsanne vehicles which were specified with the side view camera option. If the original module has been previously removed and replaced with the link loom as per previous instruction, a Yellow paint mark will be evident on the diagnostic plug surrounding cover as shown in Figure 1, please remove the loom and fit the replacement side view camera module as detailed within this document.

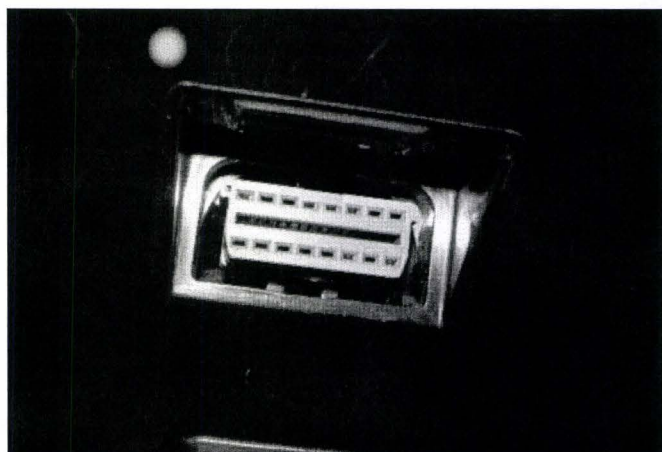


Figure 1

Should the vehicle still have the original side view camera module fitted or the link loom was installed at the time of production a Yellow paint mark will not be evident, if this is the case please replace the existing module or remove the link loom and replace with the latest specification part as detailed within this document.

**NOTE:** During this procedure the Workshop Manual is quoted, it is recommended that the procedures referenced are checked by the operative as the process within the workshop manual may have changed since last viewed.

### Remedy

From Mid-January 2013 the side view camera will again become a customer option, the latest specification part will be fitted at the time of production.

## Customer notification

Where possible please ask the customer to ensure the owners handbook is with the vehicle when they visit the Dealership to have the Campaign applied, this is to allow the addendum to be removed which was previously inserted when the original control module was removed. Please also inform your new and used car sales departments of this Campaign so that the vehicles affected can be repaired immediately.

## Warranty

### Left Hand Drive

Warranty Type 790 or 710  
Labour operation code 90 83 19 01  
Damage Service Number E775  
Damage Code 00 66  
Criteria ID 01  
Time 30 time units

### Right Hand Drive

Warranty Type 790 or 710  
Labour operation code 90 83 19 02  
Damage Service Number E775  
Damage Code 00 66  
Criteria ID 01  
Time 50 time units

## Parts

Part Number	Description	Quantity
3Y0 907 589A	Side view camera control module	1

## **Parts supply**

The required replacement part should be ordered from Bentley Motors Limited Crewe or through your regional Bentley parts distribution centre.

## **Parts despatch control**

Not applicable

## Repair instructions

### Technical background

In January 2012 a TPI was released which instructed Dealers to remove where fitted the side view camera control module as a potential fault was identified with the original part. The latest specification side view camera control module is now available for all Bentley Mulsanne vehicles which were specified with the side view camera option. If the original module has been previously removed and replaced with the link loom as per previous instruction, a Yellow paint mark will be evident on the diagnostic plug surrounding cover as shown in Figure 1, please remove the loom and fit the replacement side view camera module as detailed within this document.

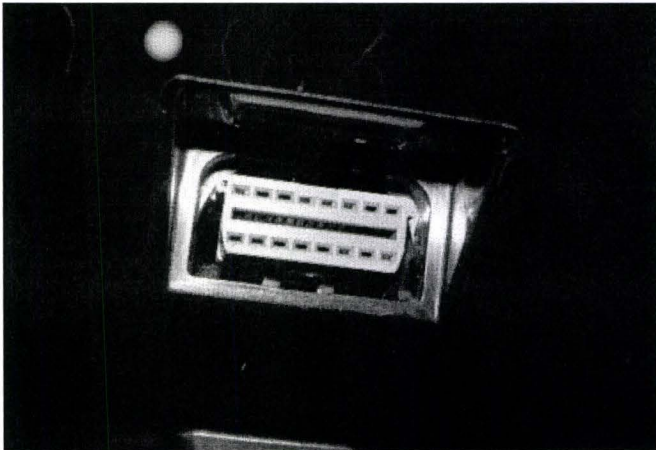


Figure 1

Should the vehicle still have the original side view camera module fitted or the link loom was installed at the time of production a Yellow paint mark will not be evident, if this is the case please replace the existing module or remove the link loom and replace with the latest specification part as detailed within this document.

**NOTE:** During this procedure the Workshop Manual is quoted, it is recommended that the procedures referenced are checked by the operative as the process within the workshop manual may have changed since last viewed.

### Check

If the vehicle is not already listed as repaired in "Repair history" (in Elsa pro), check for the Campaign completion identification mark which is a White paint mark located above the diagnostic plug cover (Figure 2) the White mark confirms the latest specification part has been fitted, should neither be evident carry out the required work in accordance with instructions.

## Parts

Part Number	Description	Quantity
3Y0 907 589A	Side view camera control module	1

## Work

1. Remove the side view control module temporary link loom or remove the existing side view camera control module - Refer to Workshop Manual Rep.Gr 94
2. Fit the latest specification control module - Refer to Workshop Manual Rep.Gr 94
3. Should the original side view camera control module have been previously removed and replaced with the link loom 3Y0 998 381 there should be a Yellow completion paint mark on the diagnostic plug surrounding cover (Figure 1), please carefully remove this and replace with a White paint completion mark as shown in Figure 2. If the original control module has been replaced for the latest specification part or the factory fitted loom has been replaced with the latest specification part, a White paint completion mark should also be added (Figure 2)
4. Remove and discard the addendum from the owners handbook which was inserted after the original control module was removed the part numbers for the addendums were as follows:  
TSD B05900 - Handbook Addendum - English  
TSD B09109 - Handbook Addendum - Multilingual

## Identification

White paint mark on the diagnostic plug surrounding cover confirms the latest specification part has been fitted.

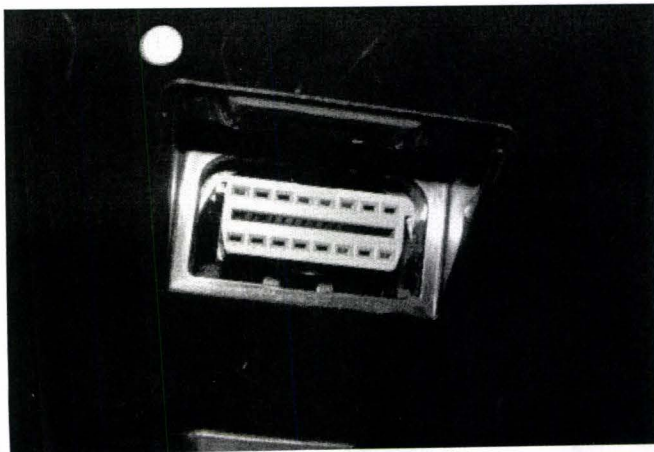


Figure 2