

Technical Service Bulletin



91 Radio: Sound cuts out above 6 mph.

91 13 77 2032966/2 March 7, 2013. Supersedes Technical Service Bulletin Group 91 number 13-75 dated February 7, 2013 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4	2013	All	Concert or Symphony Radio without Bang and Olufsen Sound System.
A5	2013		
Q5	2013		

Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised <i>Service</i> (added procedure steps)
1	2/7/13	Original Publication

- Customer concern is that there is no sound (from all audio sources) when vehicle is operated above 6 to 10 mph. When the ignition is cycled and the vehicle is stationary, the audio will work until the vehicle is driven again.
- Only vehicles with Concert Radio (PR **8UQ**) and standard sound system (PR **9VD**) are affected.

Technical Background

Not applicable.

Production Solution

Not applicable.

Technical Service Bulletin



Service

1. Check for and clear stored DTCs in the amplifier (digital sound system control module, J525 (47)).
2. Perform an SVM specified/actual comparison.
3. Disconnect scan tool, turn ignition off, lock vehicle and wait for communication bus to fall asleep.
4. Attempt to duplicate customer's original concern.
5. If the issue is still present, contact the Technical Assistance Center for further troubleshooting assistance. Attach the GFF scan and specified/actual comparison.
6. Before releasing vehicle, verify that there are no DTCs stored in the amplifier.
7. Explain to customer that the measures taken are only a temporary repair and a new solution will be released. Replacing audio system related components will not cure the issue.

Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9130		
Damage Code:	0040		
Diagnostic Time:	GFF	0150 0000	Time stated on diagnostic protocol (Max 50 TU)
	Road test prior to service procedure	0121 0002	10 TU
	Road test after service procedure	0121 0004	10 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
Claim Comment:	As per TSB #2032966/2		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

The following Technical Service Bulletin will be necessary to complete this procedure:

- TSB 2011732 *00 Software Version Management (SVM), operating instructions.*

All part and service references provided in this TSB are subject to change and/or removal. Always check with your Parts Dept. and service manuals for the latest information.