

Technical Service Bulletin



94 LED Daytime Running Light (DRL) Flickering or Intensity Change

94 13 22 2034341/1 July 11, 2013.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q5	2010 - 2012	All	Xenon headlights with LED DRLs

Condition

- Customer may report:
 - Left or Right LED Daytime Running Light (DRL) intermittently flickers.
 - Left or Right LED Daytime Running Light (DRL) intermittently lights up with more intensity then dims back to normal.
- The headlight beams still function normally.

Technical Background

The LED DRL control unit's PWM output reacts to an intermittent system voltage change, causing the LED to flicker or change intensity. DTCs will **not** be logged in the vehicle electrical system control module, J519 (address word 09). The customer complaint can only be sporadically reproduced.

Production Solution

New LED DRL control units have been released for Audi Q5 vehicles through Model Year 2012. The affected part number is **8R0907472A**. Part number **8R0907472B** is not affected.

Service

Replace affected LED DRL Control unit with updated part **8R0907472C**.

Technical Service Bulletin



Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9418		
Damage Code:	0010		
Labor Operations:	Control module LED remove+reinstall, (left)	9418 1900	40 TU
	Control module LED remove+reinstall, (right)	9418 1901	70 TU
	Control module LED remove+reinstall, (both, if necessary)	9418 2000	90 TU
Diagnostic Time:	GFF – Checking and clearing fault codes included in existing labor operations	No allowance	0 TU
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
Claim Comment:	As per TSB #2034341/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Part Number	Part Description	Quantity
8R0907472C	LED DRL Control Unit	1 or 2, as necessary

Additional Information

All parts and service references provided in this TSB (2034341) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.