

TECHNICAL BULLETIN
LTB00602NAS1
19 NOV 2013



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 501-05

Sun Visor Vanity Mirror Sliding Cover Opens/Closes While Driving

AFFECTED VEHICLE RANGE:

Range Rover Sport (LW)

Model Year: 2014

VIN: EA000001-EA313881

Range Rover (LG)

Model Year: 2013-2014

VIN: DA000001-EA137626

MARKETS:

NAS

CONDITION SUMMARY:

Situation: The sun visor vanity mirror sliding cover may open / close while driving.

Cause: This may be caused by insufficient retention of the sun visor vanity mirror sliding cover.

Action: Should a customer express this concern, follow the Service Instruction outlined below.

PARTS:



NOTE: To be sourced from the Squeaks & Rattles kit; refer to Technical Bulletin LTB00389NAS and Service Bulletin STE12-02 for more information and how to replenish the items in the Squeaks & Rattles Kit when necessary.

Felt tape (40mm X 8mm X 1mm)

Quantity: As necessary

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY:



NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIX to obtain the latest repair time.



NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Vanity mirror rework - One	05.10.10	0.1	42	LR040204/5/6
Vanity mirror rework - Pair	05.10.20	0.2	42	LR040204/5/6
Sun visor - One - Renew	76.10.47	0.1	42	LR040204/5/6




NOTE: Normal Warranty policies and procedures apply.

SERVICE INSTRUCTION:


1. Remove the affected sun visor (see TOPIx Workshop Manual, Section 501-05).
2. Lightly tap the bottom of the sun visor.
 - If the vanity mirror sliding cover opens and is loose, continue to step 3.



3. Remove the sun visor vanity mirror pack.

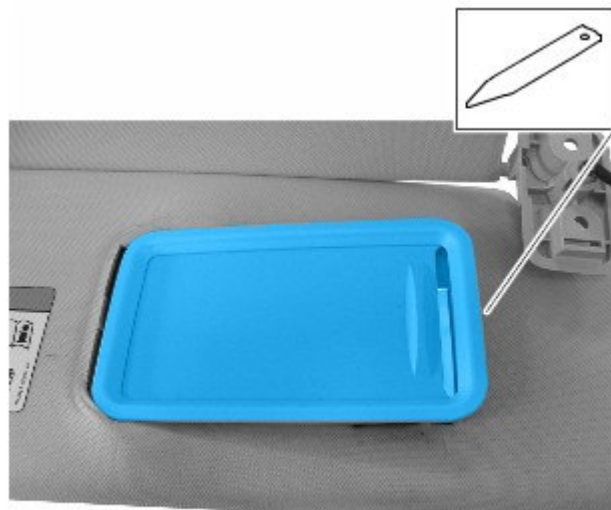

4. Remove the sun visor vanity mirror pack as shown.

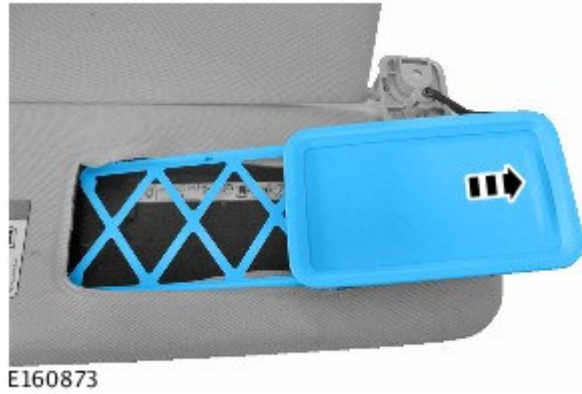

5. Apply felt tape (40mm X 8mm X 1mm) from the Squeaks & Rattles Kit to sun visor vanity mirror at the both ends of the top and bottom edges of the vanity mirror bezel as shown.




6. Install the sun visor vanity mirror pack, making sure no material is overhanging.



7. Open and close the vanity mirror sliding cover:

- Make sure there is no dirt or scratch marks on sliding cover face.
- Make sure the mirror is not cracked and close sliding cover.

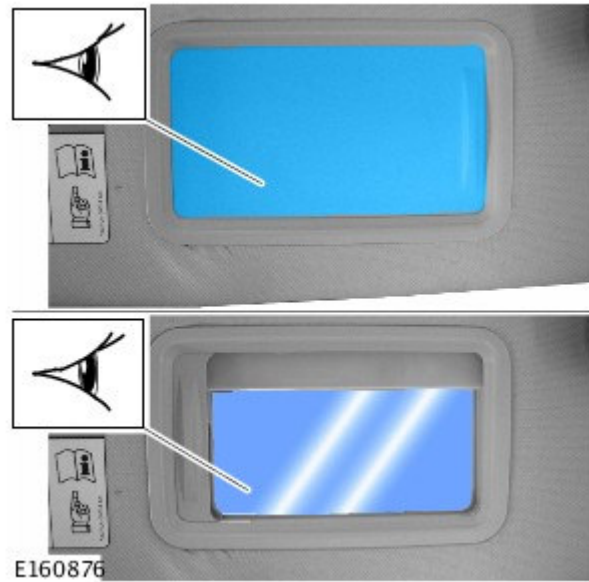

8. Lightly tap the bottom of the sun visor.

- If the vanity mirror sliding cover does not open and is not loose, continue to step 9.
- If the vanity mirror sliding cover opens and is loose, replace the sun visor.



9. Install the sun visor (see TOPIX Workshop Manual, Section 501-05).

- Make sure that the vanity light is working when the vanity mirror sliding cover is pulled back.

10. If required, repeat steps 1-9 on the other sun visor.