

Service Bulletin

Date: June, 2013

PRELIMINARY INFORMATION

Subject: Rattle/Buzz Type Noise at Center of Instrument Panel Area

Models: 2011-2012 Chevrolet Cruze Built Prior to June 16, 2011

This PI is being revised to remove the WPC part request form and update the Parts Information. Please discard PI0829.

Condition/Concern

Some customers may comment on a rattle/buzz type noise from the center instrument panel area. This noise is most pronounced at engine speeds between 1500-2000 rpm and is more noticeable on vehicles equipped with manual transmissions. The noise may be mistaken for an underhood rattle due to its location.

This condition may be caused by contact between the heater core and the HVAC case.

Recommendation/Instructions

Important: When removing the heater core there will be some coolant left in the core. Place a small drain pan under the hose fitting area of the heater core BEFORE DISCONNECTING the clamps to capture the coolant and protect the vehicle interior.

Use the following steps to install a revised foam seal to the heater core. This procedure requires that the heater core be removed and reinstalled in the vehicle.

1. Remove the heater core. Refer to Heater Core Replacement in SI.



2. With the core on the bench, remove the foam seal on the tank end.



3. Install the new seal. Start at the pipe fittings as shown.



4. Wrap the foam seal around the tank end. Ensure the ends overlap as shown.

2907497

2907500



2915480

- 5. Inspect the opposite corners of the tank and ensure the corner foam seals are in place. If the seals are not in place, install two 18 mm (3/4 in) x 60 mm (23/8 in) pieces of foam material as shown.
- 6. Reinstall the heater core. Refer to Heater Core Replacement in SI.

Parts Information

| Part Number | Description |
|-------------|-----------------------|
| 23169001 | Seal Kit, Heater Core |

Warranty Information

For vehicles repaired under warranty, use:

| Labor Operation | Description | Labor Time |
|--|----------------------------------|------------|
| 4480008* | Install Revised Heater Core Seal | 1.2 hrs |
| *This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide. | | |