



Service Bulletin

File in Section: -

Bulletin No.: PI0856A

Date: January, 2013

PRELIMINARY INFORMATION

Subject: Flutter or Rattle Noise Heard from HVAC Vent

Models: 2012-2013 Chevrolet Impala
Vehicles Built After February 15, 2012

This PI is being revised to add information in step 2 under Recommendation/Instructions.
Please discard PI0856.


Condition/Concern

Some customers may comment on a flutter or rattle noise heard from the HVAC when using the heat or A/C. This condition may be caused by loose mylar on the foam seal under the HVAC vent doors.

Recommendation/Instructions


Follow the procedure below for removing the mylar strip off the foam seal under the HVAC vent doors:

1. Remove the instrument panel carrier. Refer to Instrument Panel Carrier Replacement in SI.
2. Remove both recirculation and mode door actuators. The technician will be able to manually open the doors to get access to the foam.

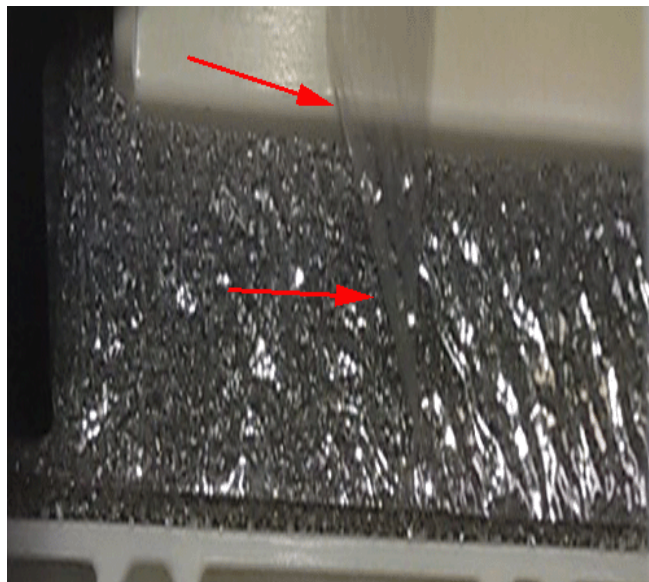

Note: Mylar strip peeling off the foam as shown in the illustration above.

2968367

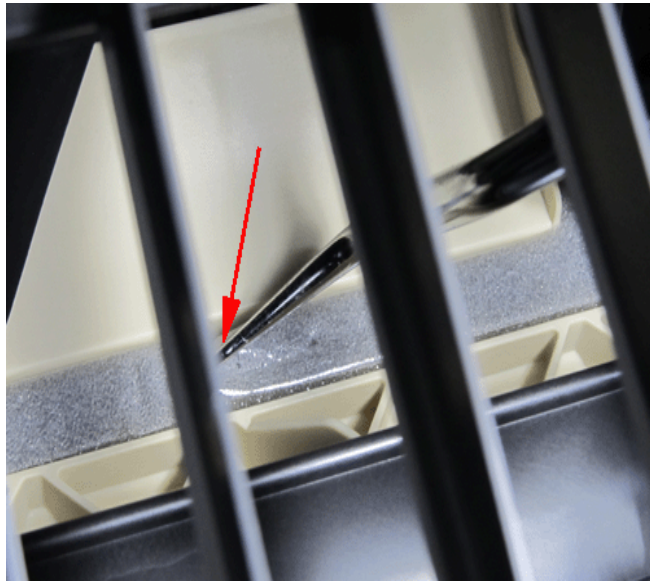

2968968

3. Using a hook pick type tool, remove the piece of mylar off the foam through the vents under the HVAC vent doors.



2968370

Note: Mylar strip removed from the foam as shown in the illustration above.

4. Install the recirculation actuators.
5. Install the instrument panel carrier.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
C9534*	Removing Mylar Strips Off the Foam Under the HVAC Vent Doors	5.5 hrs
*This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.		