



Service Bulletin

File in Section: -

Bulletin No.: PI0887B

Date: April, 2013

PRELIMINARY INFORMATION

Subject: Pulsating/Rotational Noise from Right Rear of Vehicle on Brake Apply

Models: 2012-2013 Chevrolet Cruze
Equipped with Drum Brake (RPO J93)
Vehicles Built Prior to VIN Breakpoint D7161078


This PI is being revised to add a VIN Breakpoint. Please discard PI0887A.

Condition/Concern

Some customers may comment about a pulsating/rotational noise coming from the right rear of the vehicle during brake apply.

This noise may be caused by an interaction between the brake drum and brake shoe.

Recommendation/Instructions

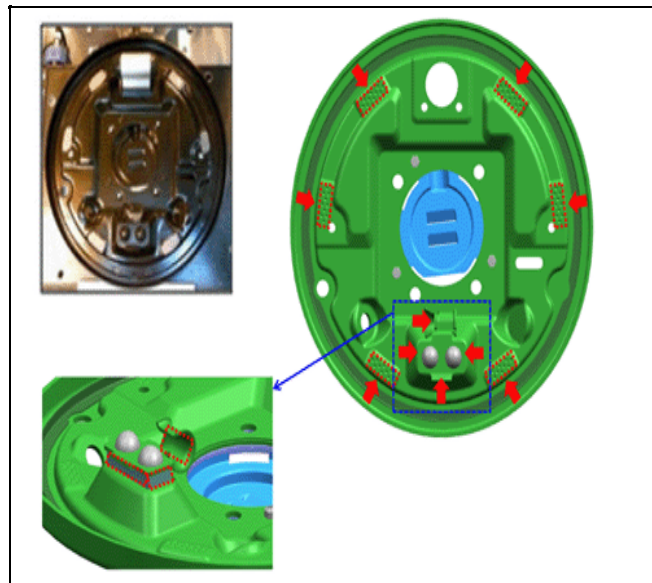

2965726

The right rear brake drum and rear brake shoes need to be replaced including applying a high temperature grease, GM P/N 12345996 (in Canada, 10953501), or equivalent, on all the locations of the backing plate as shown in the illustration above.

Note: DO NOT replace the left rear drum as this noise condition only pertains to the right side.

Parts Information

Part Number	Description	Qty
13435981	Drum, Rear Brake	1
13381403	Shoe Kit, Rear Brake	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
H9768*	Replacing Right Rear Drum and Shoe Kit Includes Greasing the Applied Position of Backing Plate	0.9 hr

*This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.