



File in Section: -

Bulletin No.: PI0927

Date: March, 2013

Service Bulletin

PRELIMINARY INFORMATION

Subject: Squeak/Creak Type Noise from Driver and/or Passenger Seat Track Front Mounting Area

Models: 2010-2013 Chevrolet Camaro
Built Prior to November 7, 2012

Condition/Concern


Some customers may comment on a squeak/creak type noise from the driver and/or passenger seat track front mounting area.


This may be caused by the seat front hooks not centered in the floor/body slots, making a metal squeak/creak noise.

Recommendation/Instructions

Install a spacer between the front seat track hooks for the driver and passenger seats following the procedure below.

1. Remove the bolts from the seat tracks on the driver and passenger front seats. Refer to Driver or Passenger Seat Removal and Installation in SI.

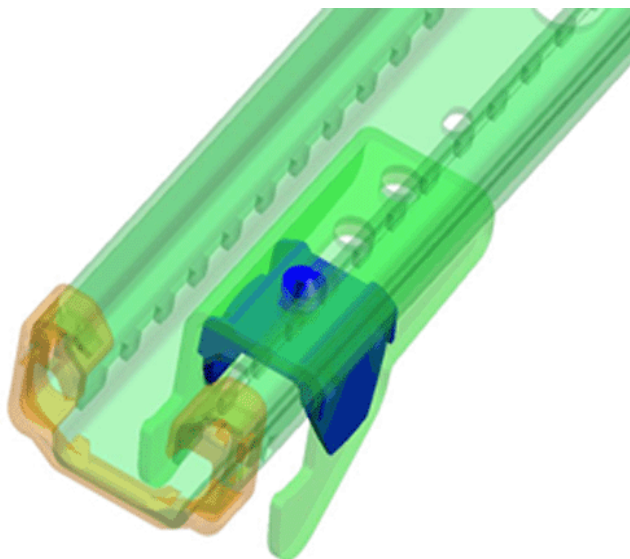

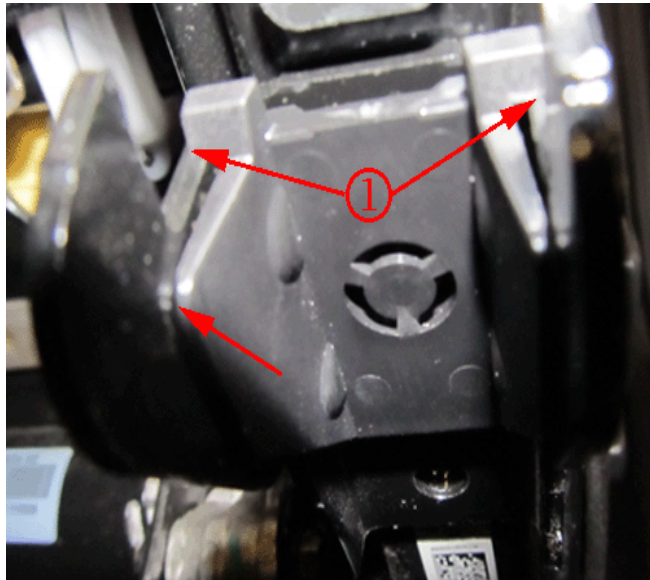

3284116

2. Install the spacer to the outboard track on the driver and passenger front seats with the ears (1) resting on the upper back of the hook as shown in the illustration above.

Note: This spacer is a unique design for the Camaro.

3. Reinstall the driver and passenger seats.

Tighten

Tighten the bolts to 45 N•m (33 lb ft).

Parts Information

Part Number	Description	Qty
22953940	Spacer, Track Hook Insulator	1 Per Seat

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
C9541*	Installing Spacer Between Driver and Passenger Outboard Front Seat Hook	0.4 hr
*This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.		