



File in Section: -

Bulletin No.: PI0937

Date: March, 2013

Service Bulletin

PRELIMINARY INFORMATION

Subject: Service Engine Soon (SES) Light On with DTC P0137 Set

Models: 2013 Buick Verano
Equipped with 2.4L Engine (RPO LEA)

Condition/Concern

Some customers may comment the service engine soon (SES) light is on. Upon inspection, a technician may find DTC P0137 set with additional DTCs associated with the heated oxygen sensor.



3329640

This condition may be caused by the heated oxygen sensor coming in contact with the axle shaft on the passenger side.

Recommendation/Instructions



3329843

Replace the heated oxygen sensor and route the pigtail wires away from the axle shaft. Loop the pigtail wires in a knot as shown in the illustration above before installing the new sensor. Only tie the loop knot as tight as necessary to make the connection to the harness; a tight knot increases the likelihood of damage to the internal wires.

Parts Information

Part Number	Description
12637298	Sensor, Heated Oxygen

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
J6380	Heated Oxygen Sensor Replacement	Use Published Labor Operation Time