



# Service Bulletin

File in Section: -

Bulletin No.: PI0954

Date: April, 2013

## PRELIMINARY INFORMATION

**Subject:** Service Suspension Message With Any Malfunction Codes C0595, C0600, C0605, C0670 or C0675 with Symptom 0A After Accelerometer Replacement

**Models:** 2010 Buick LaCrosse  
Equipped with RPO F45  
Built Prior to January 31, 2010

### Condition/Concern

Service Suspension Message with any malfunction codes C0595, C0600, C0605, C0670 or C0675 with Symptom 0A after Accelerometer replacement.

Replacement accelerometers are incompatible with the OE Controller. When replacing any of the 5 vehicle accelerometers, the controller must also be replaced. The new controller is compatible with both OE and Service accelerometers.

### Recommendation/Instructions

Replace the Suspension Control Module.

### Parts Information

Part Number	Description
20923493	Module, Electronic Suspension Control

### Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
E5911	Electronic Suspension Control Module Replacement	Use Published Labor Operation Time