File in Section: -

Bulletin No.: PI0965

Date: May, 2013

PRELIMINARY INFORMATION


Subject: Squeaking/Creaking Type Noise Heard When Using Clutch Pedal

Models: 2012-2013 Chevrolet Sonic

Equipped with Manual Transmission (RPOs MZ4, M26)

Condition/Concern


Some customers may comment on a squeaking/creaking type noise heard when using the clutch pedal.

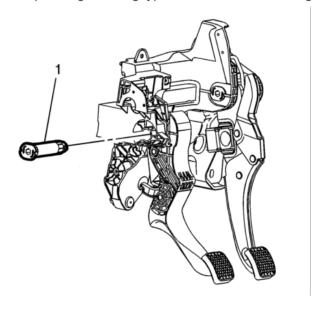

3412540

This may be caused from lack of or no lubrication on the clutch pedal pin (1) shown in the illustration above.

Recommendation/Instructions

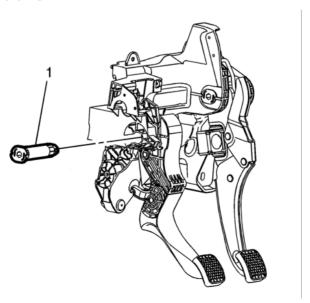

Apply GM Super Lube Part Number 12346241 (in Canada use 10953474) or equivalent around all the gaps on the clutch pedal pin (1) in the illustration above.

Note: DO NOT remove the clutch pedal pin during the lubrication process.

Warranty Information

For vehicles repaired under warranty, use:

| Labor Operation | Description | Labor Time |
|--|------------------------------|------------|
| K9903* | Lubricating Clutch Pedal Pin | 0.2 hr |
| *This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide. | | |