



Service Bulletin

File in Section: -

Bulletin No.: PI0971

Date: May, 2013

PRELIMINARY INFORMATION

Subject: Outside Rearview Mirror Remote Control Switch Inoperative (Fuse Blown)

Models: 2012-2013 Chevrolet Sonic
Built Prior to December 22, 2012

Condition/Concern

Some customers may comment that the outside rearview mirror remote control switch, located on the driver side door interior trim panel, is not functioning. When diagnosing this condition, the customer or technician may find the fuse for the outside rearview power mirrors is blown. This fuse is located in the underhood fuse block.

This condition may be caused by pushing down on the power mirror remote control knob, while positioning the mirror in the up-down or in-out functions.

Recommendation/Instructions

An updated outside rearview mirror remote control switch has been released to correct this condition.

Use the following steps to correct the condition.

1. Verify the outside rearview mirror fuse is blown. This fuse is located in the underhood fuse block. If the fuse is blown, proceed to the next step. If the fuse is good, proceed with normal SI diagnostic procedures.
2. Replace the outside rearview mirror remote control switch. Refer to Outside Rearview Mirror Remote Control Switch Replacement in SI.
3. Replace the 7.5 amp outside rearview mirror fuse located in the underhood fuse block.
4. Verify the outside rearview mirror control switch functions correctly.

Parts Information

Part Number	Description
95328440	Switch, Outside Rearview Mirror

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2050470	Outside Rearview Mirror Remote Control Switch Replacement	Use Published labor Operation Time