



Service Bulletin

File in Section: -

Bulletin No.: PI0986

Date: June, 2013

PRELIMINARY INFORMATION

Subject: Rattle Noise from Engine Compartment


Models: 2012-2013 Buick Enclave
2012-2013 Chevrolet Traverse
2012-2013 GMC Acadia
Built Prior to April 11, 2013

Condition/Concern


Some customers may comment on a rattle noise coming from the engine compartment, most noticeable between the 600-800 RPM range.

The check valve in the fuel line may not have been properly crimped in the line and may create a rattle. The crimped clamp often can be turned on the hose if the clamp has not properly captured on the check valve.

Recommendation/Instructions

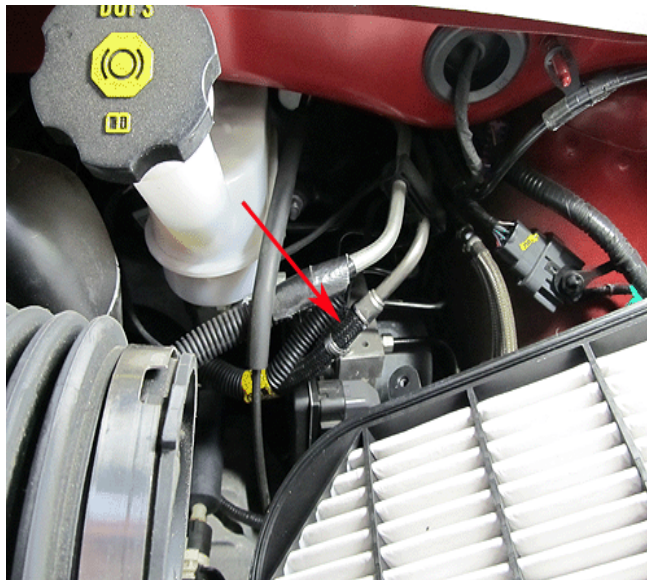

3458739

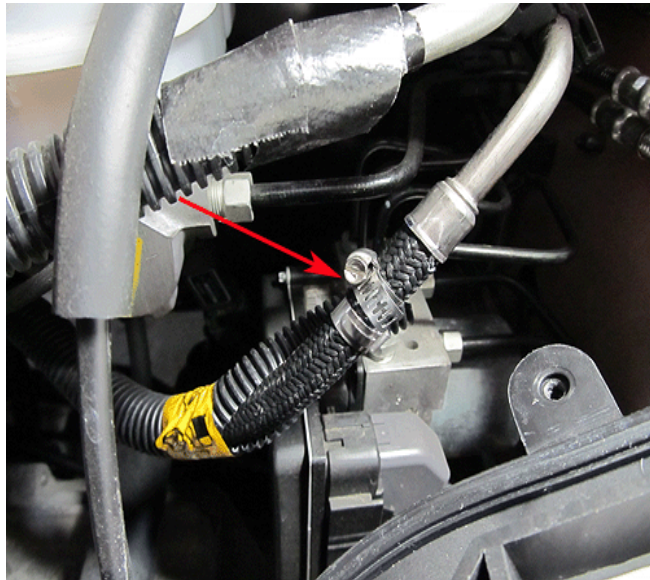

3458742

Remove the air cleaner housing cover and install a worm drive hose clamp next to the crimped clamp to properly secure the check valve as shown above.

Parts Information

Part Number	Description	Material Allowance
P28910M01* or Equivalent	Worm Drive Hose Clamp (3/8" to 7/8" Hose O.D)	\$2.00 (Canada \$2.25)
*This product is currently available from Kent Industries (1-888-YES-KENT or www.kent-automotive.com).		

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
4080068*	Install Clamp to Fuel Line Check Valve	0.3 hr
*This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.		