

|               |   |
|---------------|---|
| Reference     | SSM68858  |
| Models        | Range Rover Sport / L320<br>LR3 / L319                                |
| Title         | 09MY Range Rover Sport or LR3 MIL illuminated & DTC<br>P0430 or P0420 |
| Category      | Engine  |
| Last modified | 11-Oct-2013 00:00:00  |
| Symptom       | 403000 Exhaust System Concerns  |

**Please retain parts if you carry out a repair as detailed below:**

Issue:

**09MY**

**Range Rover Sport 4.2 S/C or 4.4 NA or LR3  
4.4 NA**

**-Repair triggered due to MIL light caused by  
DTC P0430 or P0420.**

**-Mileage - any**

**-No previous incidence of misfire DTC P03xx**

Cause:

**Possible fault with exhaust catalytic  
converter or O2 sensors.**

Content

Action:

**Please replace both banks of the exhaust  
catalyst even though the diagnosis only  
indicates a single side to be replaced. Retain  
the following parts for possible return to aid  
investigation:**

**WCD502470 ( 7H22 9N497 DB ) (RH Cat)**

**WCD502480 ( 7H22 9N497 EB ) (LH Cat)**

**Plus: The four O2 sensors must remain  
intact & still fitted to the exhaust.**

**Please submit an EPQR so collection of the  
parts can be arranged.**