

Reference	SSM69118
Models	Range Rover (All New) / L405 Range Rover Sport / L494
Title	Engine MIL & code in the range P2400-00 to P240C-85 or P2418-00, P2419, P2420
Category	Engine
Last modified	18-Nov-2013 00:00:00
Symptom	404000 Fuel System Concerns
Content	<u>Issue:</u> The engine MIL is illuminated and one of the following DTS's are set: P2400-00, P2401-00, P2402-85, P2404-00, P2405-00, P2406-00, P2407-00, P240A-00, P240B-00 , P240C-85, P2418-00, P2419 or P2420.
	<u>Cause:</u> If no fault is found on the vehicle, the cause may be an internal DMTL pump fault
	<u>Action:</u> Please raise an EPQR providing detail of diagnostic work undertaken. Replace the DMTL pump and retain the original DMTL pump for return. The UK factory will arrange shipping of the replaced component. Parts are only required where one of the following DTC's are found: P2400-00, P2401-00, P2402-85, P2404-00, P2405-00, P2406-00, P2407-00, P240A-00, P240B-00 , P240C-85, P2418-00, P2419 or P2420.C
	Parts are not required from cases where only an evaporative leak code is found.