



Service Bulletin

File in Section: -

Bulletin No.: PIC5793A

Date: March, 2013

PRELIMINARY INFORMATION

Subject: Water Leak On Driver Floor And/Or Various Electrical Concerns With Possible Communication Or Powertrain Codes

Models: 2012 - 2013 Buick Verano

This PI was superseded to Admin Details. Please discard PIC5793.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

A customer may comment of a water leak on the driver side floor. The vehicle may exhibit any of the following concerns; intermittent no fob detected, no crank no start, park brake light flashing, a rough running concern, SES light on, power locks locking on their own, Service Park Assist message. Upon dealership diagnosis the technician may find multiple communication or powertrain codes.

Recommendation/Instructions

Inspect the X200 for water intrusion or corrosion and replace any of the terminals that are corroded. If water intrusion is found inspect the windshield for voids in seam sealer and reseal the windshield.

Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
C0020	Windshield Resealing	Use Published Labor Operation Time

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.