



Service Bulletin

File in Section: -

Bulletin No.: PI1034A

Date: August, 2013

PRELIMINARY INFORMATION

Subject: Check Engine Light On with DTC P0442 Set

Models: 2014 Chevrolet Impala

This PI has been revised to remove the Engine RPO. Please discard PI1034.

Condition/Concern

Some customers may comment on a check engine light being on. The technician may find DTC P0442 set.



3603856

This condition is due to the seal on the fuel tank filler pipe housing not seated properly during vehicle assembly, causing a small EVAP leak and the seal to overlap the fuel tank filler neck as shown in the illustration above.

Recommendation/Instructions

Using a trim stick, push the seal over the filler neck and clear the DTC.

Warranty Information

For vehicles repaired under the U.S. (3 years / 36,000 miles) or Canadian (3 years / 60,000 km) Bumper-to-Bumper Warranty, use:

Labor Operation	Description	Labor Time
1480118*	Reposition the Fuel Tank Filler Pipe Housing Seal and Clear DTC	0.4 hr
*This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.		