



# Service Bulletin

File in Section: -

Bulletin No.: PI1042A

Date: September, 2013

## PRELIMINARY INFORMATION

**Subject:** Diagnostic Tips for Unable to Shift Transmission Out of Park, Interior Lamps Inoperative and Left Rear Stop/Turn Lamp Inoperative

**Models:** 2013-2014 Cadillac ATS

This PI has been revised to update the Condition/Concern section to add the last bullet. Please discard PI1042.

### Condition/Concern

Some customers may comment on any of the following concerns:

- Unable to shift transmission out of PARK (automatic only).
- Reading lamps are inoperative.
- Puddle lamps are inoperative.
- Courtesy/Dome lamps are inoperative.
- Sunshade lamp is inoperative.
- Instrument panel compartment (glove box) lamp is inoperative.
- Left rear stop/turn lamp is inoperative.

Further inspection may reveal that the 10 amp BCM 7 fuse (location 31) in the underhood fuse block is open (blown). These conditions may be caused by one of the sunshades having a short to ground at the mounting base or internally at the pivot/extension tube.

### Recommendation/Instructions

Disconnect the driver and passenger sunshade one at a time to see if the condition goes away.

- If the root cause is determined to be a short in the sunshade, replace the affected sunshade.
- If the root cause is determined to NOT be a short in the sunshade, refer to published diagnostics in SI to diagnose the remaining circuits.

### Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
1040390	Sunshade Replacement	Use Published Labor Operation Time