



# Service Bulletin

File in Section: -

Bulletin No.: PI1076A

Date: October, 2013

## PRELIMINARY INFORMATION

**Subject:** Revised Front License Plate Bracket Installation Instructions

**Models:** 2014 Chevrolet Malibu

This PI has been revised to add a Parts Information table and a Warranty Information statement. Please discard PI1076.

### Condition/Concern

The front license plate bracket attachment package contains four rivets, and two of those rivets are not long enough to secure the bracket at the upper mounting hole locations.

### Recommendation/Instructions



3632266

Obtain the two new longer rivets, GM P/N 11516936, and perform the following:

1. Using a 13/64 in (5 mm) drill bit, drill the two upper bracket mounting holes using the dimples in the grille as a guide.
2. Position the license plate bracket to the grille and install the two P/N 11516936 rivets.
3. Using a 13/64 in (5 mm) drill bit, drill the two lower bracket mounting holes using the holes in the bracket as a guide.
4. Install the two rivets that were included in the license plate attachment package, in the lower bracket mounting holes.

### Parts Information

Part Number	Description	Qty
11516936	Rivet	2 per vehicle

## **Warranty Information**

The labor time for installing this bracket is included in the PDI time. The parts cost for the rivets may be submitted in the "miscellaneous net" field using the PDI Add labor code 0590032. Submit this claim as a ZPDI claim type.