



# Service Bulletin

File in Section: -

Bulletin No.: PI1088

Date: October, 2013

## PRELIMINARY INFORMATION

**Subject:** Information on Proper Auxiliary Power Connections


**Models:** 2011-2014 Chevrolet Caprice PPV  
Equipped with Auxiliary Battery RPO K4S or K5S

### Condition/Concern

Improper electrical connections using the power studs on the isolation relay rather than the provided power studs. Any added power circuit in the trunk electrical center should not utilize the studs on the isolation relay.

### Recommendation/Instructions

The Caprice PPV equipped with the auxiliary battery utilizes an isolation relay to protect the auxiliary battery from being discharged during engine starting. To eliminate the possibility of improper power tapping, refer to the image below to identify the location of the proper power taps on vehicles equipped with the auxiliary battery, which is located in the trunk of the vehicle directly behind the RH wheel.

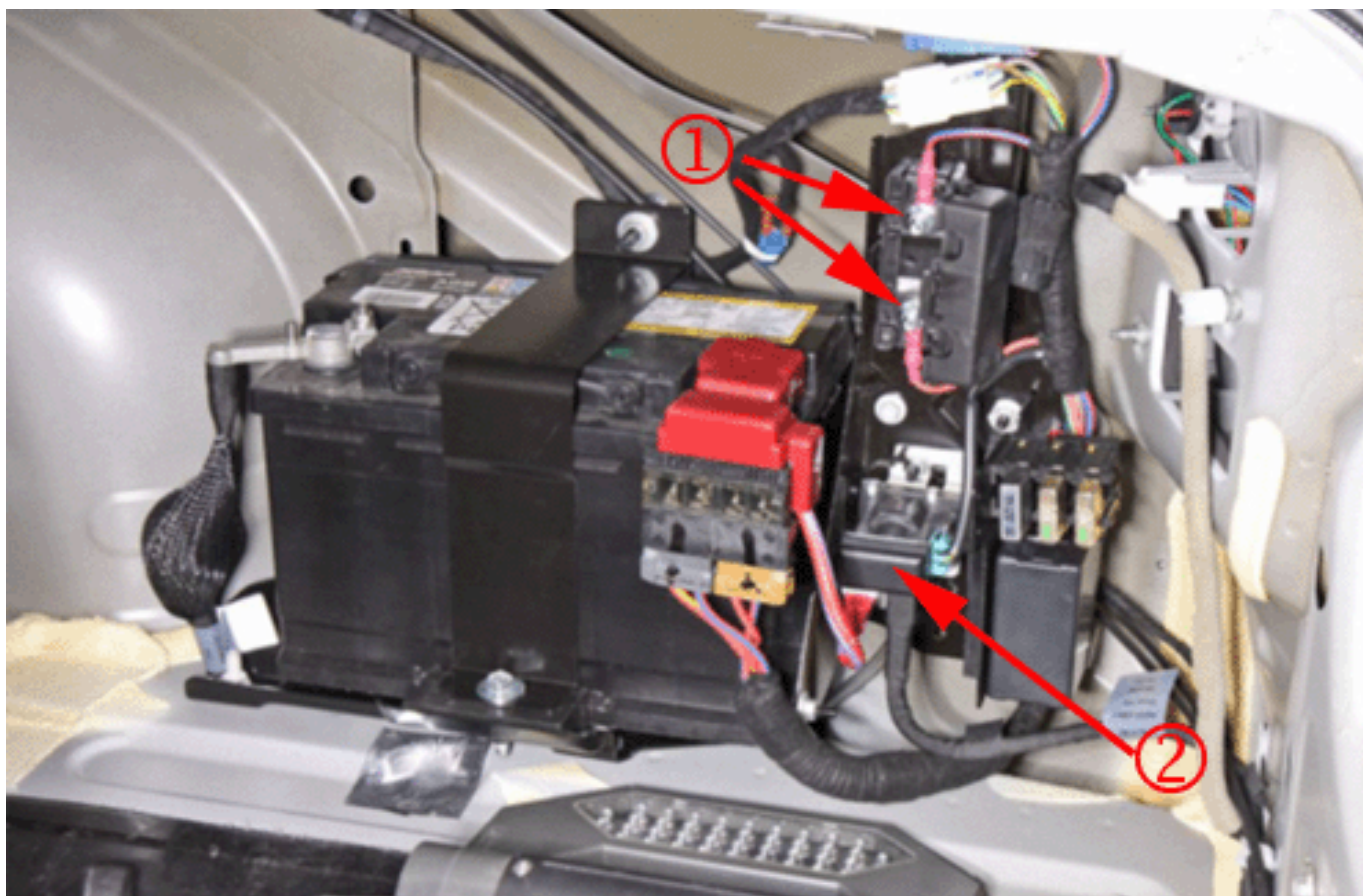

3634969

### Legend

- (1) Auxiliary Power Taps (shown with cover open)
- (2) Isolation Relay - DO NOT use as power taps