



Service Bulletin

File in Section: -

Bulletin No.: PI1096

Date: November, 2013

PRELIMINARY INFORMATION

Subject: Accessory Chrome Fuel Door Does Not Sit Flush or Binds After Installation

Models: 2014 Chevrolet Silverado 1500
2014 GMC Sierra 1500

Condition/Concern

Some technicians may notice or customers may comment that the accessory chrome fuel door does not sit flush or binds during operation.

Recommendation/Instructions

Important: It is critical that the rivets listed in this bulletin are used for this repair. These rivets contain corrosion protection.

The installation instructions for the accessory chrome fuel door have been revised for better fit and operation. When installing the accessory chrome fuel door, utilize two rivets in place of the supplied u-nuts and bolts. If a customer returns to the dealership with the above concern, replace the current fasteners with rivets. In the near future, the accessory chrome fuel door package will be updated with rivets.

Parts Information

Part Number	Description	Qty
11611736	Rivet	2

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
0580028*	Accessory Chrome Fuel Door Installation Fastener Change	0.0 hr
0580038**	Replace Accessory Chrome Fuel Door Fasteners with Rivets	0.2 hr

*This is a unique labor operation for bulletin use to cover part cost only. Use this labor operation if the change was performed during the installation. The required labor is included in 0590032 for the LPO accessory and included in the customer paid installation cost when installed as an ACO.

**This is a unique labor operation for bulletin use only. Use this labor operation if the change was performed after the installation. It will not be published in the Labor Time Guide.