



Service Bulletin

File in Section: -

Bulletin No.: PI1137

Date: December, 2013

PRELIMINARY INFORMATION

Subject: Temperature and Blower Speed Knobs Difficult to Rotate and/or Make a Clicking Noise


Models: 2014 Chevrolet Corvette
Condition/Concern

Some customers may comment that the knobs are difficult to turn and/or make a clicking noise when attempting to adjust the blower speed or the interior temperature on the HVAC control.

Recommendation/Instructions

Technicians should remove a portion of the 3 detents on the control knobs following the procedure below:

1. Gently remove the HVAC control knobs.

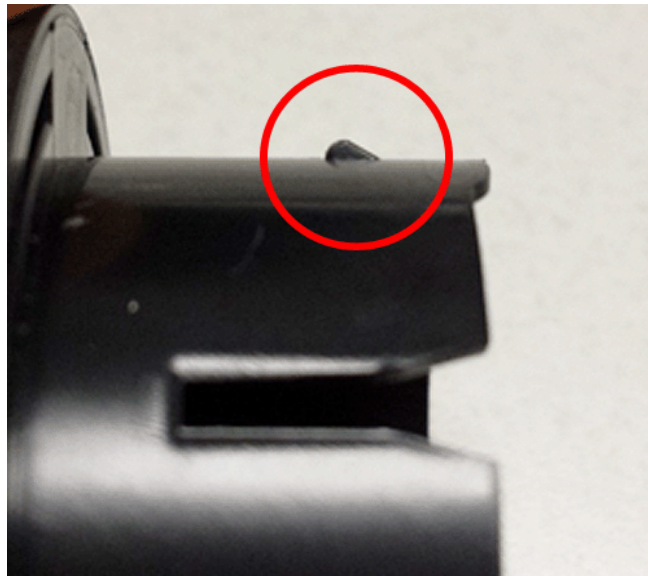



3669835



3669842



3669841

2. With a sharp tool, remove the red portion of each detent as shown above.

Important: Be sure not to remove too much or all of the detent. The HVAC control knob will not seat and be loose if too much material is removed.

3. Install the HVAC control knobs and verify proper operation.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
4480128*	Modify HVAC Control Knobs	0.3 hr
*This is a unique labor operation for bulletin use only. It will not be published in the Labor Time Guide.		