



# Service Bulletin

File in Section: -

Bulletin No.: PI1143

Date: December, 2013

## PRELIMINARY INFORMATION

**Subject:** Service Steering Message Displayed on Drivers Information Center (DIC), DTC C0544 Set

**Models:** 2014 Chevrolet Corvette  
**Condition/Concern**

Some customers may comment on a Service Steering message displayed on the drivers information center (DIC). Technicians may find DTC C0544 stored in history.

This may be caused by the vehicle's computer system detecting a difference in wheel speed with the front wheels compared to the rear wheels. No loss of steering control or power steering assist occurs when this condition is encountered.

### Recommendation/Instructions

Dealership personnel should explain to the customer that this condition can occur when transitioning from slippery roads to dry roads. The message on the DIC will go out on the next key cycle or by pressing the SEL button on the steering wheel. The technician needs to remove the DTC from history.

**Note:** **DO NOT** replace any parts for this condition.