



Service Bulletin

File in Section: -

Bulletin No.: PI01518A

Date: April, 2013

PRELIMINARY INFORMATION

Subject: 4.6L LH2 Engine DTC P0011 P0014 P0021 P0024 P0300 After Engine Repairs

Models: 2004 Cadillac SRX with 4.6 RPO LH2

This PI was superseded to edit title and Condition/Concern . Please discard PIO1518.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

Engine runs rough on light accel during the first two minutes of a key cycle and sets DTC P0011 P0014 P0021 P0024 P0300.

This is a problem that can occur after other engine services that may have disturbed the cam actuator wire harness.

Recommendation/Instructions

Inspect to be sure the cam actuator harness has been installed correctly.

Note: Correct routing of the cam actuator harness has it coming up from below the intake on the right (passenger) side of the throttle. The short branch connects to the right head and the long branch connects to the left head. There are tags on the harness labeled left and right.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.