

Reference	SSM58597
Models	XJ / X351 F-TYPE / X152
Title	TPMS low pressure warning displayed.
Category	Electrical
Last modified	06-Jun-2013 00:00:00
Symptom	206000 Warning Indicators
Content	<p>Issue: A customer may report that a spare wheel low tyre pressure warning is displayed in the Instrument Pack message centre, when no full size spare wheel is present.</p> <p>Cause: There is a scenario where an incorrect spare wheel ID may be learnt by a vehicle that will then display a low pressure warning, specifically for the spare wheel, even if the vehicle is fitted with a non TPMS spare i.e Space Saver or Instant Mobility System (IMS). This issue is unlikely to occur, but probability is increased after the use of wheels with no TPMS sensors fitted.</p> <p>Action: If the above scenario occurs, please follow the Tyre Pressure Monitoring System (TPMS) wheel sensor replacement procedure using Symptom Driven Diagnostics (SDD) to ensure wheel unit identification numbers are updated. Select the option of a full size spare wheel and program this to 00 00 00 00. (Regardless of the Space saver / IMS actual option on the vehicle)</p>