

Reference	SSM66737
Models	F-TYPE / X152
Title	DTC C1A96-64 Flagged - Various instrument cluster warning lights
Category	Chassis
Last modified	08-Jul-2013 00:00:00
Symptom	301000 Service Brake System

**Content**

**Issue:**  
A Customer may report various warning Lights are shown on their Vehicles Instrument Cluster whilst driving, ABS/DSC/TC & Cruise. DTC C1A96-64 and or PCM 0703-62 may be registered.

**Cause:**  
This issue is currently under investigation within Jaguar Engineering.

**Action:**  
To aid diagnosis -Remove & refit the Brake Light Switch following these steps:

1. Ensure the brake pedal is in its normal rest position. Please note; if you depress the pedal, the switch will be damaged when it is removed.
2. Twist the switch in a clockwise direction, and remove from the bracket.

**Process for re-fitting the switch**

1. Ensure that the brake pedal is in its normal resting position. Please note: the pedal must not be depressed when the switch is fitted.
2. Locate the switch in the bracket aperture, and twist in an anti-clockwise direction using light finger pressure to avoid deflection of the switch bracket during re-fitment.

TOPIX will be updated shortly to reflect this update.