

ATTENTION:

GENERAL MANAGER
 PARTS MANAGER
 CLAIMS PERSONNEL
 SERVICE MANAGER

IMPORTANT - All
 Service Personnel
 Should Read and
 Initial in the boxes
 provided, right.



QUALITY DRIVEN® SERVICE

SERVICE BULLETIN

APPLICABILITY: 2012MY Impreza with 2.0L NA FB Engine

NUMBER: 11-128-13

SUBJECT: ECM Reprogramming for DTCs P0017 and P0019

DATE: 02/08/13

INTRODUCTION

This Bulletin announces the availability of ECM reprogramming to address DTCs P0017 and P0019.

PACK FILE APPLICABILITY

NOTE: SSMIII version 1.36.50.7 dated January, 2013 (or newer) is required to install these updates and perform the Service Procedure outlined on pg. 2.

ENGINE / EMISSION SPEC	TRANSMISSION	PAK FILE NAME	NEW ECM PART NUMBER	OLD ECM PART NUMBERS	OLD CID NUMBERS	NEW CID NUMBER
2.0L CAL	CVT	22765AC424.pak	22765AC424	22765AC420 22765AC421 22765AC422 22765AC423	EP5F400B EP5F401B EP5G500B EP5G600B	EP5G601B
	MT	22765AC404.pak	22765AC404	22765AC400 22765AC401 22765AC402 22765AC403	EP5F401A EP5G210A EP5G500A EP5G600A	EP5G601A
2.0L FED	CVT	22765AC384.pak	22765AC384	22765AC380 22765AC381 22765AC382 22765AC383	EP5F400D EP5F401D EP5G500D EP5G600D	EP5G601D
	MT	22765AC364.pak	22765AC364	22765AC360 22765AC361 22765AC362 22765AC363	EP5F401C EP5G210C EP5G500C EP5G600C	EP5G601C

Continued...

CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

SUBARU OF AMERICA, INC. IS "ISO 14001 COMPLIANT"

The international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.

SERVICE PROCEDURE

When P0017 and/or P0019 is stored:

- Reprogram the ECM
- Perform Inspection Mode
- Did any DTCs reset?

YES- Replace the ECM with the latest part number

NO- The procedure is complete

ACCESSING INSPECTION MODE

Using the Service Diagnostics tab on the STIS home page, enter your vehicle search parameters (example: 2012 > Impreza). Next, enter the specific DTC into the search term box. Select the applicable link from your search result (example: ENGINE (DIAGNOSTICS) (H4DO) > Inspection Mode > PROCEDURE). Follow the procedure as outlined to completion.

WARRANTY / CLAIM INFORMATION

For vehicles within the Basic New Car Limited and / or Emissions Warranty period, this repair may be claimed using the following information:

LABOR DESCRIPTION	LABOR OPERATION #	FAIL CODE	LABOR TIME
Reprogram ECM for P0017 / 0019, Perform Inspection Mode, No DTCs Reset	B455-119	U00-48	0.4
Replace ECM When DTCs Reset After Reprogramming for P0017 / 0019	C455-229		0.2